


STANDARDS CODE	2-7045		SHEET 2 OF 7	5804983
CIRCUIT APPROVAL	GMR	07-07-65	STATUS	ACTIVE
LOCATION	POUSHKEEPSIE			APPROVED
RAW CARD NUMBER	5816451	1	HOLE PATTERN	5816451
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5816451	02-16-65	162219	07-05-66	167712
BACK ARTWORK	07-24-65	164624	B	
5816451	10-04-65	165307	C	

PIN/VOLT.	PIN/VOLT.	CODE	PART NO	VALUE	QTY
002 +23	G11 + 6	R 1	216442	680.000	.25 + 5 6
B11 + 6	D03 + 3	R 2	216437	430.000	.25 + 5 12
J03 + 3	D07 -18	R 3	595359	100.000	.25 + 5 13
B06 - 3	G06 - 3	R 4	216439	510.000	.25 + 5 1
D08 GND	J08 GND	R 5	216459	4.300K	.25 + 5 4
B05 GND	B09 GND	C 1	350453	1. N	1
D11 GND	G05 GND	C 2	5301516	39. P	1
G09 GND	G10 GND	CR 1	2391143	HY	12
		Q 1	369177	101 PNP	24
		Q 2	2390104	270 NPN	1
		Z 1	361482	SLT MODULE	1
		Z 2	361453	SLT MODULE	6
		Z 3	361439	SLT MODULE	6
		Z 4	361468	SLT MODULE	1
		A 1	2414883	RC MODULE	9
		A 2	2390418	RC MODULE	1
		HA			12
		HB	811157		10
		HB	811399		01
		HS	815192		14

NOTES:
AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
AZ-PART CRY MUST NOT BE SUBJECTED TO ANY LIQUID. HAND SOLDER.
SOLDER JOINT TO NOT TO EXCEED 500 DEGREES F OR 260 DEGREES C FOR MORE THAN 5 SEC. SEE VIEW FOR MOUNTINGS.
AX-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.
FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
ADDITIONAL USAGE TO BE AVOIDED
HA-ASSEMBLE WITH PIN 811157 PTO-18-1 SPACER.
HB-ASSEMBLE WITH PIN 811399 PTO-5-1 SPACER.
HS-ASSEMBLE WITH PIN 815192 PTO-18-1 INSULATING SPACER

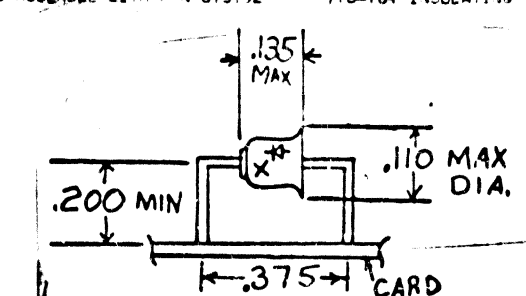

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME CARD ASM-LCS FINAL AMPLIFIERS				
WITH 5 ROBE DRIVER				
DESIGN	12-18-64	R25	TYPE	2361
DETAIL	12-18-64	R25	SCALE	NONE
CHECK	01-26-65	MFR	DRAW	17090 100-00-00
APPRO	07-07-65	GMR	LOC. NO.	5804983C LAMINATED

