STANDARDS CODE	2-7045			5801212
CIRCUIT APPROVAL	IE	07-21-64	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	5816853 1		HOLE PATTERN	5816853
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO
5816853	06-26-64	DEV2762		
BACK ARTWORK	08-12-64	161662		
5816853				

PIN	VOLT.
B06	-03
D03	+03
D06	GR
G06	-03
G12	+36
J02	+12

CODE	PART NO	VALUE	QTY
R 1	508040	68.000 .50 + 5	1
R 2	216445	1.000K .25 + 5	1
R 3	216458	3.900K .25 + 5	1
R 4	216438	470.000 .25 + 5	1
R 5	481793	909.000K .50 + 1	1
R 6	216437	430.000 .25 + 5	1
R 7	355683	51.000 1.00 + 5	1
R 8	595357	3.000K .25 + 5	1
R 9	216453	2.200K .25 + 5	1
R10	216481	36.000K .25 + 5	1
R11	216465	7.500K .25 + 5	1
C 1	2123013	5. U	1
CR 1	369599	DO	1
CR 2	597877	DT	2
Q 1	2414922	260 NPN	
Q 2	2414878	254 NPN	
Q 3	369390	084 NPN	1
Z 1	361497	SLT MODULE	1
FL	811399		2
HB	811399		1

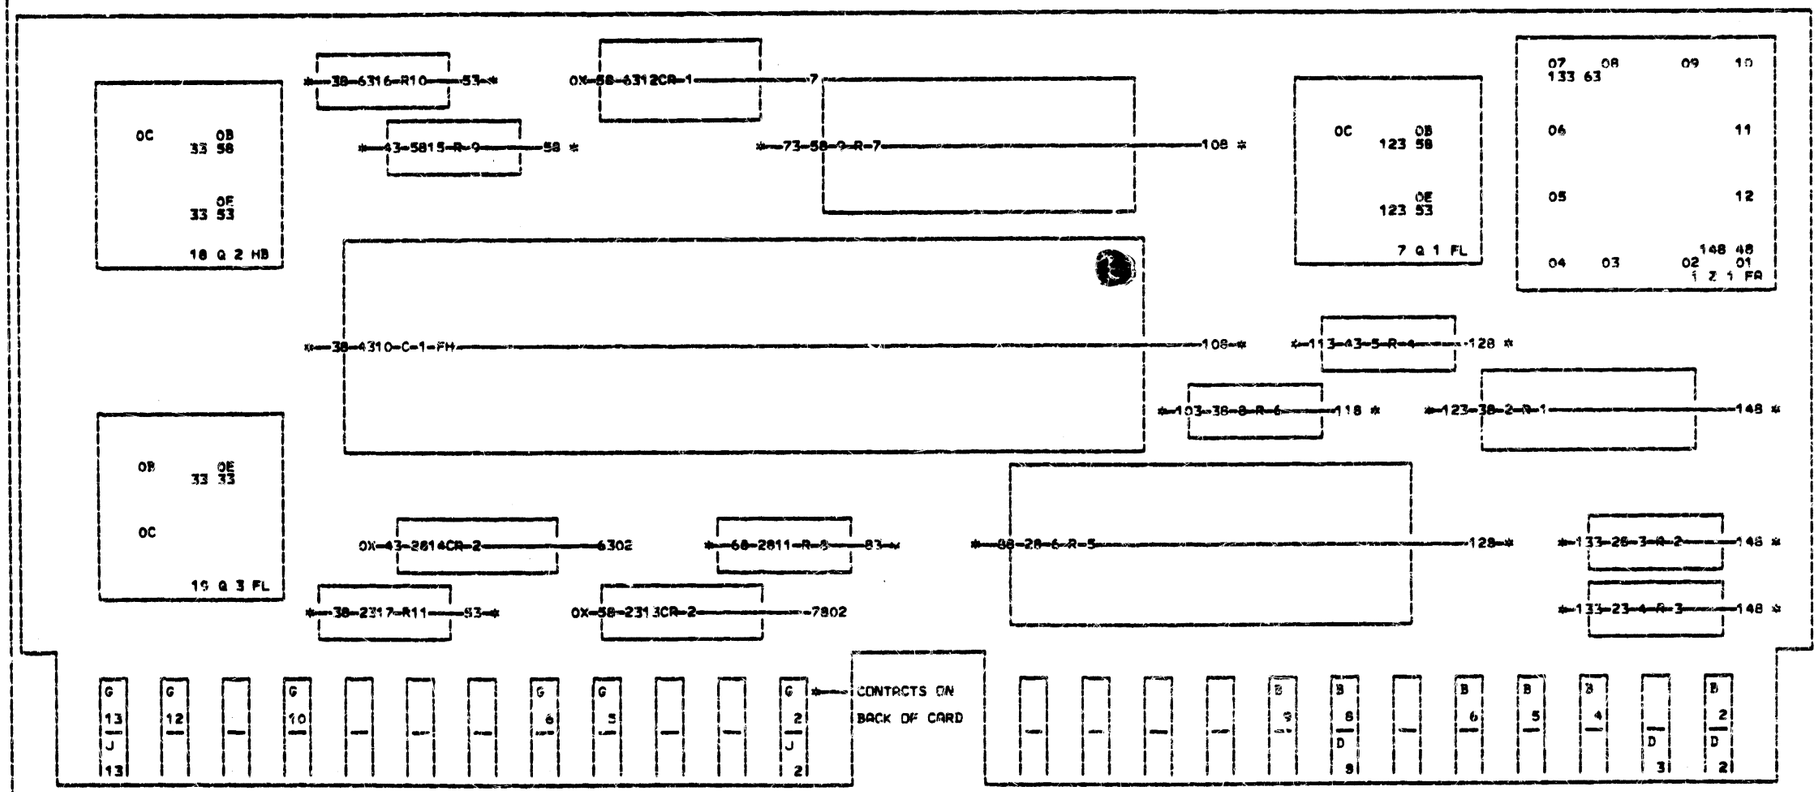

NOTES.

AA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFCATION 890913

AL-CARD HAS NOT BEEN DECOUPLED 811800 IS NOT APPLICABLE.

FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL. ADDITIONAL USAGE TO BE AVOIDED

FH-DUE TO COMPONENT HEIGHT OF .370 TO .4600 THIS CARD MUST BE REMOVED PRIOR TO REMOVAL OF CARD ADJACENT TO COMPONENT SIDE.

FL-ASSEMBLE WITH P/N 811399 SPACER. TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL. ADDITIONAL USAGE TO BE AVOIDED.

HB-ASSEMBLE WITH P/N 811399 .70-.5 SPACER.

INTERNATIONAL BUSINESS MACHINES CORP.

NAME 2 SEC TIMER

DESIGN	05-05-64	FC	TYPE	2321	
DETAIL	05-05-64	FC	SCALE	NONE	
CHECK	05-06-64	RT	DRAW	7090	09-04-64
APPRO	05-06-64	SRS	SHEET	OF 3	

5801212