STANDARDS CODE	Z-7045			5800741
CIRCUIT APPROVAL	EWE	10-19-64	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	5817034		HOLE PATTERN	5817034
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO
5817034	10-23-64	162075		
BACK ARTWORK				
5817034				

PIN	VOLT.
D03	+12
D08	GR

CODE	PART NO	VALUE	QTY
R 1	482141	98.700K .25 + 1	1
R 2	216425	75.000 .25 + 5	1
R 3	216448	1.300K .25 + 5	1
R 4	483082	22. K .12 + 1	1
R 5	216431	180.000 .25 + 5	1
R 6	216738	620.000K .25 + 5	1
C 1	2391250	68.000U	1
Q 1	369682	131 PNP	1
Z 1	381497	SLT MODULE	1
R 1	2390467	RC MODULE	1
HS	811157		1

NOTES.

RA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

AL-CARD HAS NOT BEEN DECOUPLED. 811800 IS NOT APPLICABLE.

FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
ADDITIONAL USAGE TO BE AVOIDED

HS-ASSEMBLE WITH P/N 811157 (TO-18 SPACER).

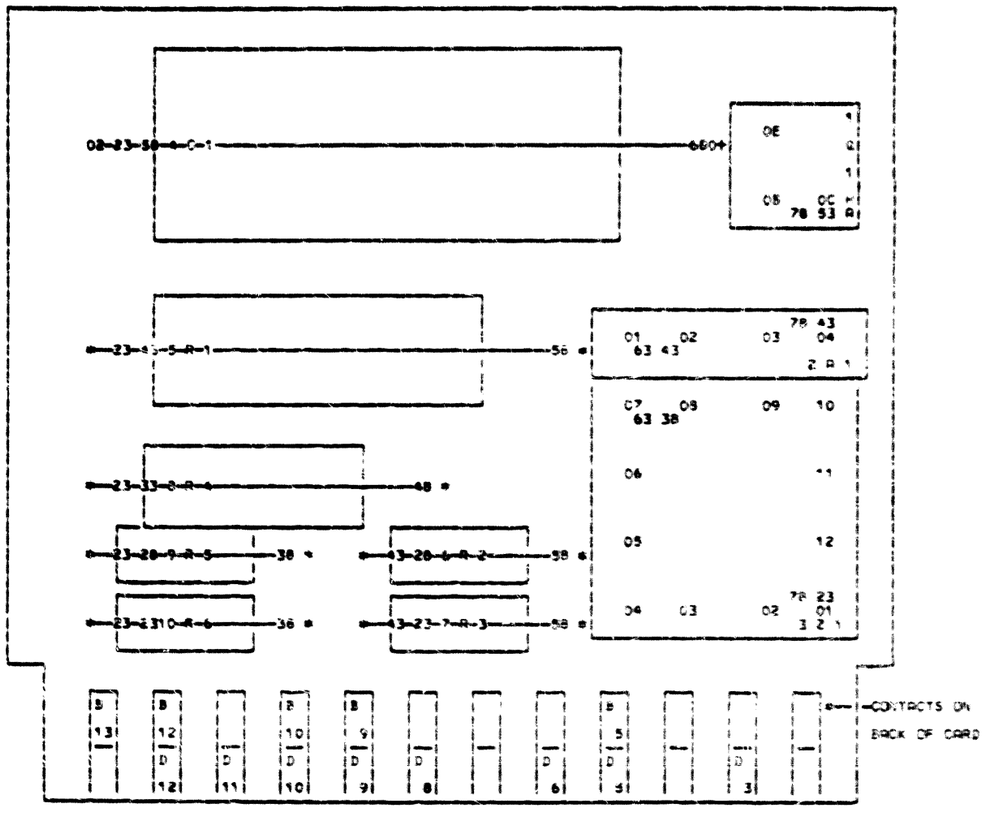

INTERNATIONAL BUSINESS MACHINES CORP.

NAME	75 SECONDS TIMEOUT				
DESIGN	10-08-64	TH	TYPE	1070	
DETAIL	10-08-64	TH	SCALE	NONE	
CHECK	10-16-64	RT	DRAW	7090	09-29-64
APPRO	10-16-64	SRS	SHEET	2 OF 3	

5800741