STANDARDS CODE	2-7045			5001215
CIRCUIT APPROVAL	IE	08-03-64	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	5816877 1		HOLE PATTERN	5816877
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO
5816877	07-23-64	160538		
BACK ARTWORK	09-21-61	161266		
5816877				

PIN	VOLT.
B03	-12
B07	-12
D08	GR
G10	-12
J03	+12
J08	GR

CODE	PART NO	VALUE			QTY
R 1	216468	10.000K	.25	+ 5	1
R 2	216469	11.000K	.25	+ 5	1
R 3	216445	1.000K	.25	+ 5	1
R 4	595357	3.000K	.25	+ 5	1
R 5	317014	680.000	.50	+ 5	4
R 6	213714	1.800K	.50	+ 5	2
R 7	323920	3.000K	.50	+ 5	5
Q 1	369682	131 PNP			1
Q 2	369686	175 NPN			1
Z 1	361494	SLT MODULE			3
Z 2	361499	SLT MODULE			1
A 1	2414863	RC MODULE			2
HA	811157				2

NOTES.

AA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.

FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL ADDITIONAL USAGE TO BE AVOIDED

HA-ASSEMBLE WITH P/N 811157 (TO-18) SPACER.

HD- HAND ASSEMBLE BEFORE LIQUID PROCESS.

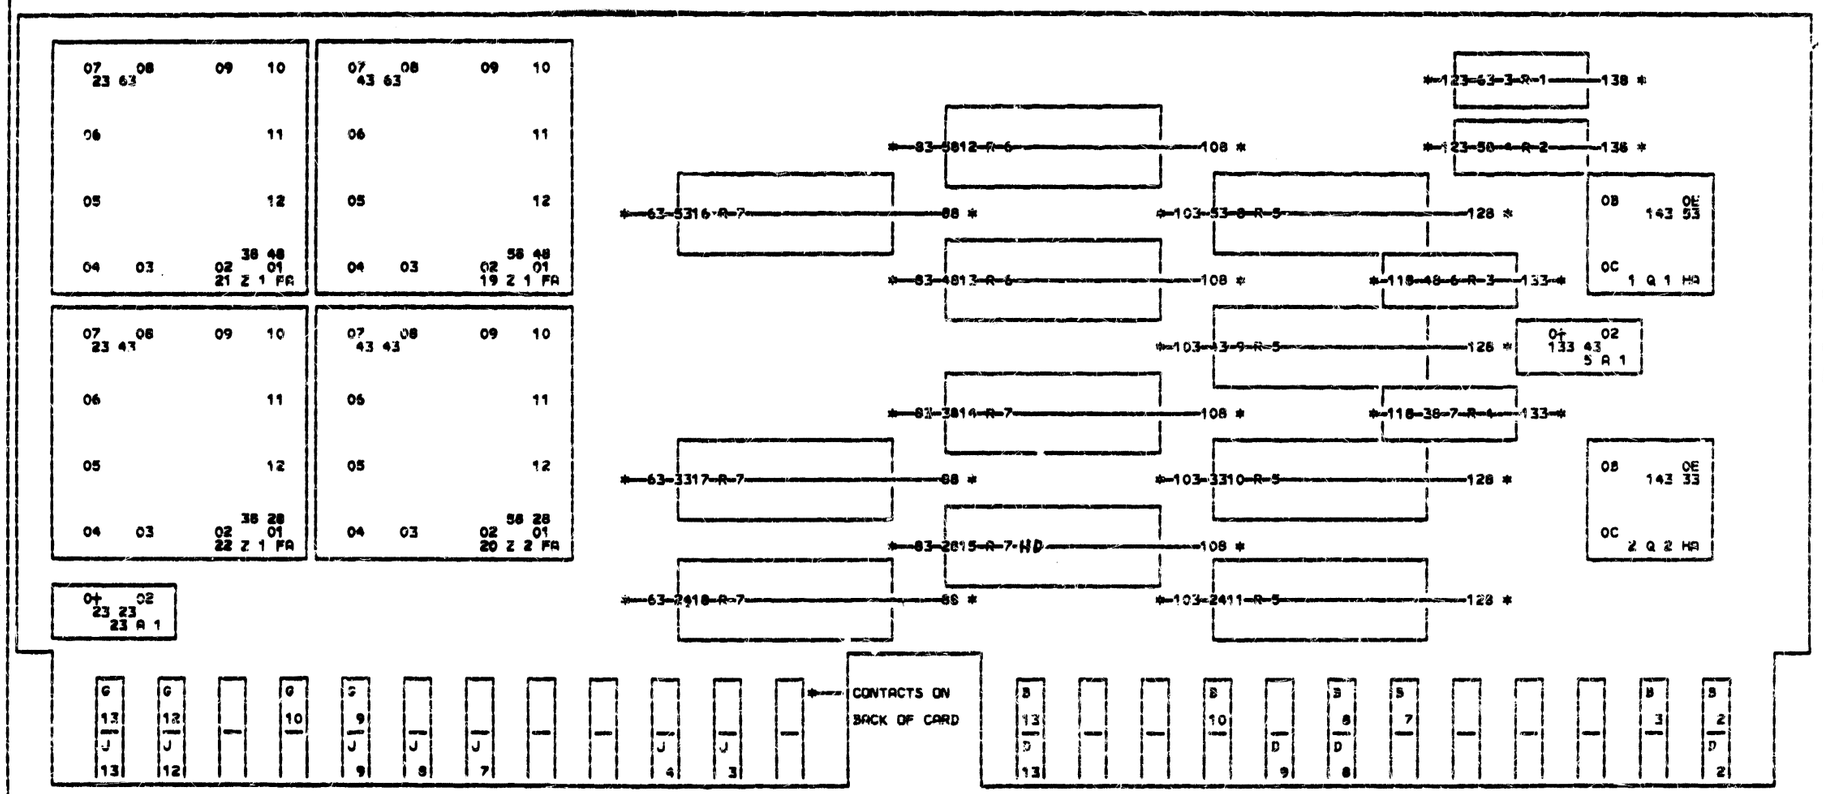

INTERNATIONAL BUSINESS MACHINES CORP.

NAME	TRANSFER CARD				
DESIGN	09-10-64	TH	TYPE	1070	
DETAIL	09-10-64	TH	SCALE	NONE	
CHECK	09-11-64	RT	DRAW	7090	09-04-64
APPRO	09-11-64	SAS	SHEET 2 OF 3		

5801215