STANDARDS CODE	2-7045			SHEET 2 OF 4	5801424
CIRCUIT APPROVAL	GFF	06-15-66		STATUS	ACTIVE
LOCATION	POUGHKEEPSIE				APPROVED
RAL CARD NUMBER	5817930			HOLE PATTERN	5817930
FRONT ARTWORK	DATE	CHANGE NO.		DATE	CHANGE NO.
5817930	11-03-66	169233	A		
BACK ARTWORK					
5817930					

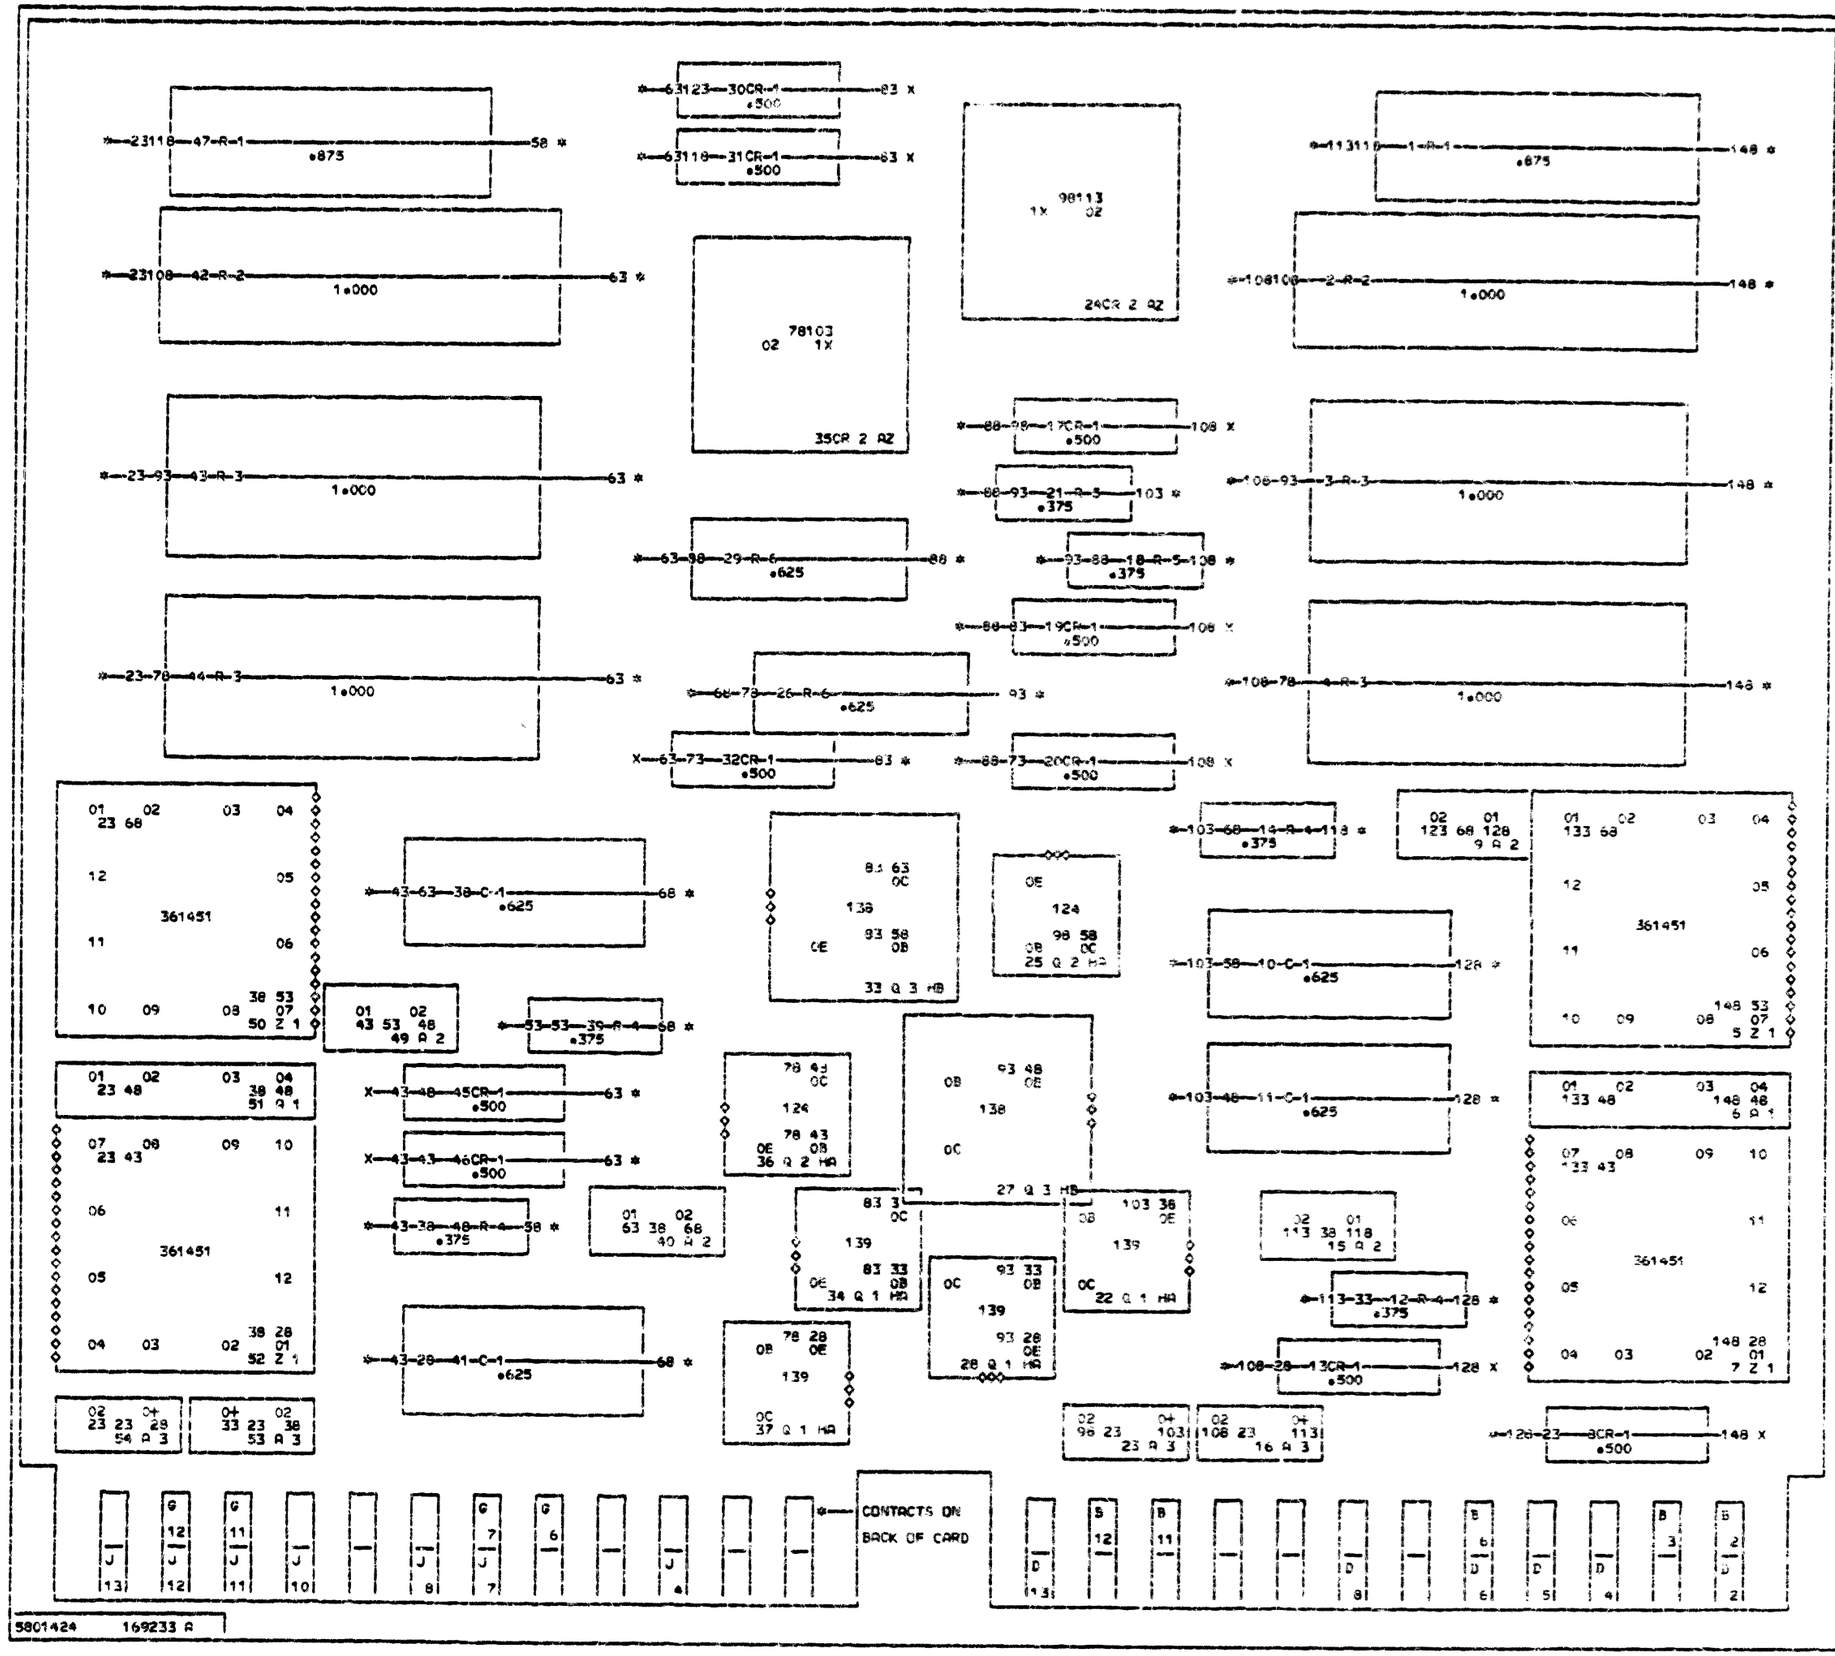

PIN	VOLT.	PIN	VOLT.
B12	-12	D12	-12
B06	- 3	D06	- 3
B11	+ 6	G11	+ 6
D08	GND	G08	GND

CODE	PART NO	VALUE			QTY
R 1	492670	511.000	.25	+ 1	2
R 2	481537	562.000	.50	+ 1	2
R 3	216988	91.000	2.00	+ 5	4
R 4	216455	2.700K	.25	+ 5	4
R 5	216432	2.000K	.25	+ 5	2
R 6	317010	430.000	.50	+ 5	2
C 1	350416	33. P			4
CR 1	369118	CE			10
CR 2	369600	DP			2
Q 1	2414938	139 PNP			4
Q 2	369656	124 PNP			2
Q 3	2414918	138 PNP			2
Z 1	361451	SLT MODULE			4
A 1	2390555	RC MODULE			2
A 2	2390237	RC MODULE			4
A 3	2414883	RC MODULE			4
AZ	811399				2
FA					4
HA	811157				06
HB	811399				02

NOTES.

AA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

AZ-ASSEMBLE WITH P/N 811399 TO5 SPACER. DIODE LEADS NOT TO BE BENT IN ANY WAY. DO NOT SUBJECT TO ANY LIQUIDS. CATHODE LEAD COMMON TO CASE.

AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.

FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL. ADDITIONAL USAGE TO BE AVOIDED

HA-ASSEMBLE WITH P/N 811157 PTC- SPACER.

HB-ASSEMBLE WITH P/N 811399 PTC SPACER.

INTERNATIONAL BUSINESS MACHINES CORP.

NAME	CARD ASM-VIDEO ADDER				
DESIGN	06-10-66	CFC	TYPE	2948	
DETAIL	06-14-66	CFC	SCALE	NONE	
CHECK	06-15-66	FLP	JRPL	7090	10-26-66
APPRO	06-15-66	GHF	L.C.N.	5801424	LAMINATED

5801424 169233 A