| | | | | |
|---|---|---|---|---|
| STANDARD CODE | 3-7045 | | | 5903082 |
| CIRCUIT APPROVAL | | - - | STATUS | |
| LOCATION | | | | |
| APW CARD NUMBER | 5015566 | | HOLE PATTERN | 813069 |
| FRONT ARTWORK | DATE | CHANGE NO. | DATE | CHANGE NO |
| 5015565 | 4-9-64 | 160302 | | |
| BACK ARTWORK | | | | |
| 5015567 | | | | |

RESTRICTED

| PIN | VOLTS |
|---|---|
| D08 | GR |
| D03 | +12 |

| CODE | PART NO | VALUE | QTY |
|---|---|---|---|
| R 1 | 322742 | 30.000 .50 + 5 | 8 |
| R 2 | 216985 | 68.000 2.00 + 5 | 2 |
| R 3 | 132772 | 36.000 1.00 + 5 | 2 |
| R 4 | 216449 | 1.300K .25 + 5 | 2 |
| Q 1 | 369686 | 178 NPN | 4 |
| HS 1 | 811838 | HEAT SINK | 2 |
| FR | 811157 | | 4 |
| NE | 483151 | | 21 |

NOTES.

AA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 290913

AC-CARD CONFORMS TO ENGINEERING SPECIFICATION 890918.

FA-ASSEMBLE WITH P/N 811157 SPACER. TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL. ADDITIONAL USAGE TO BE AVOIDED.

NE-MOUNT HEAT SINK USING SI GREASE (P/N 483151) ON THE TRANSISNE-TOR CAN. SI GREASE MUST BE APLIED AFTER LIQUID PROCESS. DUE NE-TO COMPONENT HEIGHT OF .370 TO .4600 THIS CARD MUST BE REMOVNE-ED PRIOR TO REMOVAL OF CARD ADJACENT TO COMPONENT SIDE.

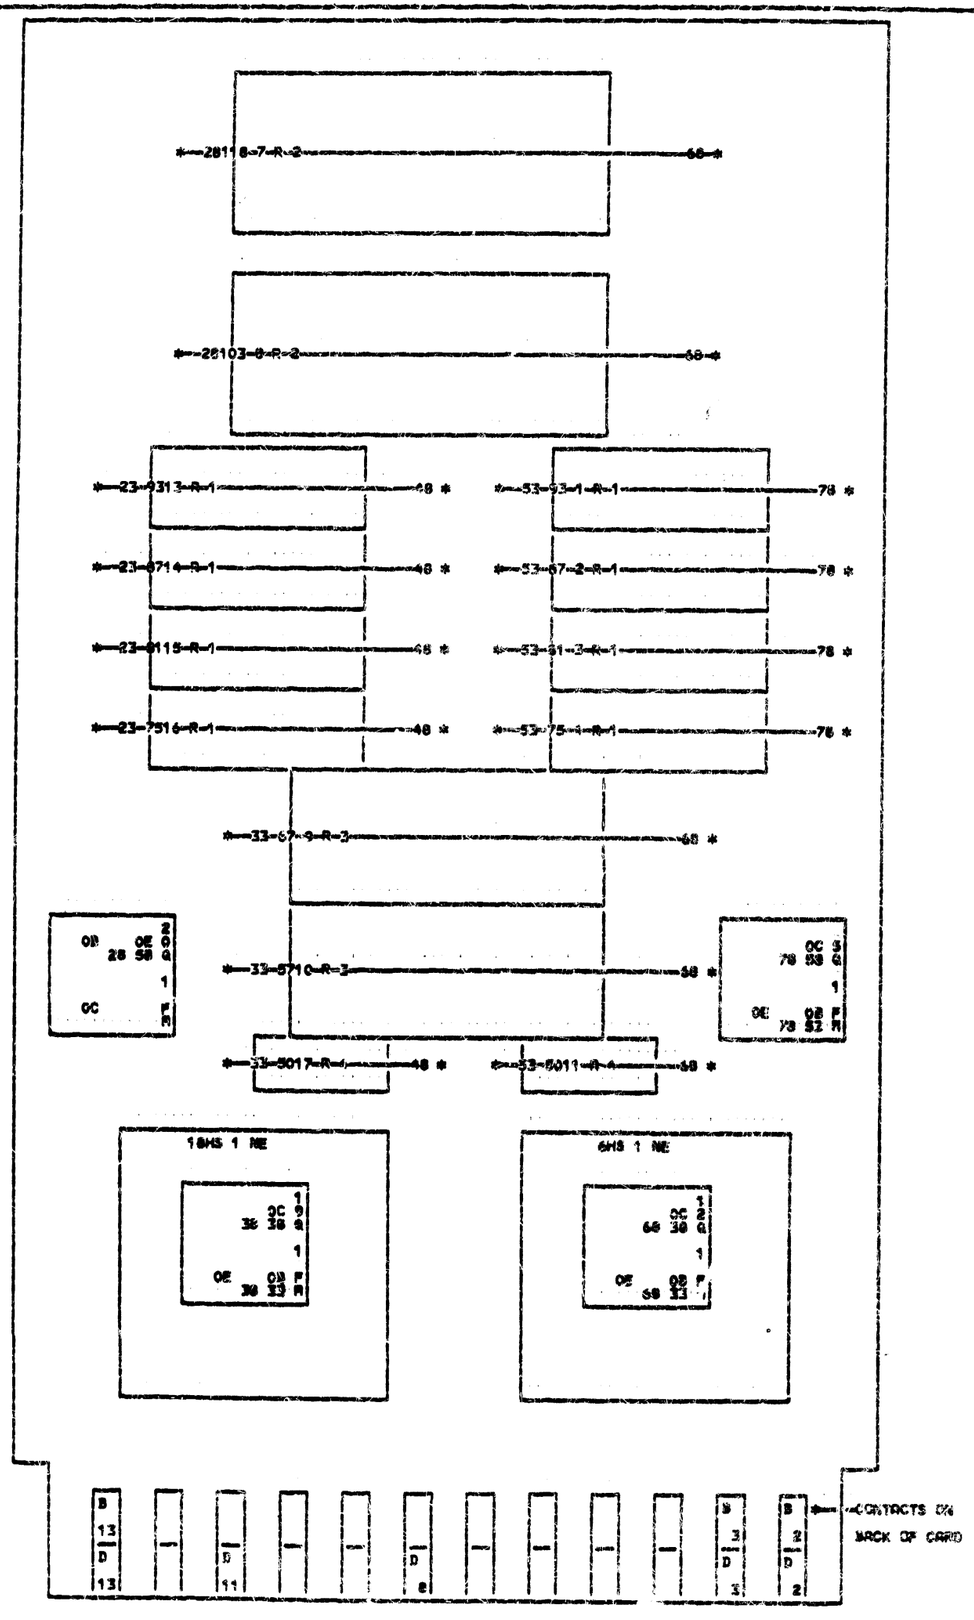


INTERNATIONAL BUSINESS MACHINES CORP.

NAME DRIVER FOR 2ns APP DRIVER

| | | | | | |
|---|---|---|---|---|---|
| DESIGN | 03-02-64 | R H | TYPE | | |
| DETAIL | 03-20-64 | RBE | SCALE | NONE | |
| CHECK | 03-24-64 | TH | DWG | 7090 | 03-24-64 |
| APPRD | - - | | SHEET | OF | |

5903082