| | | | | | |
|---|---|---|---|---|---|
| STANDARDS CODE | 2-7045 | | | SHEET 2 OF 4 | 5804331 |
| CIRCUIT APPROVAL | W P | 01-19-65 | | STATUS | ACTIVE |
| LOCATION | ENDICOTT | | | | RESTRICTED |
| RAW CARD NUMBER | 5815655 3 | | | HOLE PATTERN | 5815655 |
| FRONT ARTWORK | DATE | CHANGE NO. | | DATE | CHANGE NO |
| 5815655 | 06-03-64 | DEV3630 | | | |
| BACK ARTWORK | 10-29-64 | 161926 | | | |
| 5815655 | 04-02-65 | 162143 | B | | |

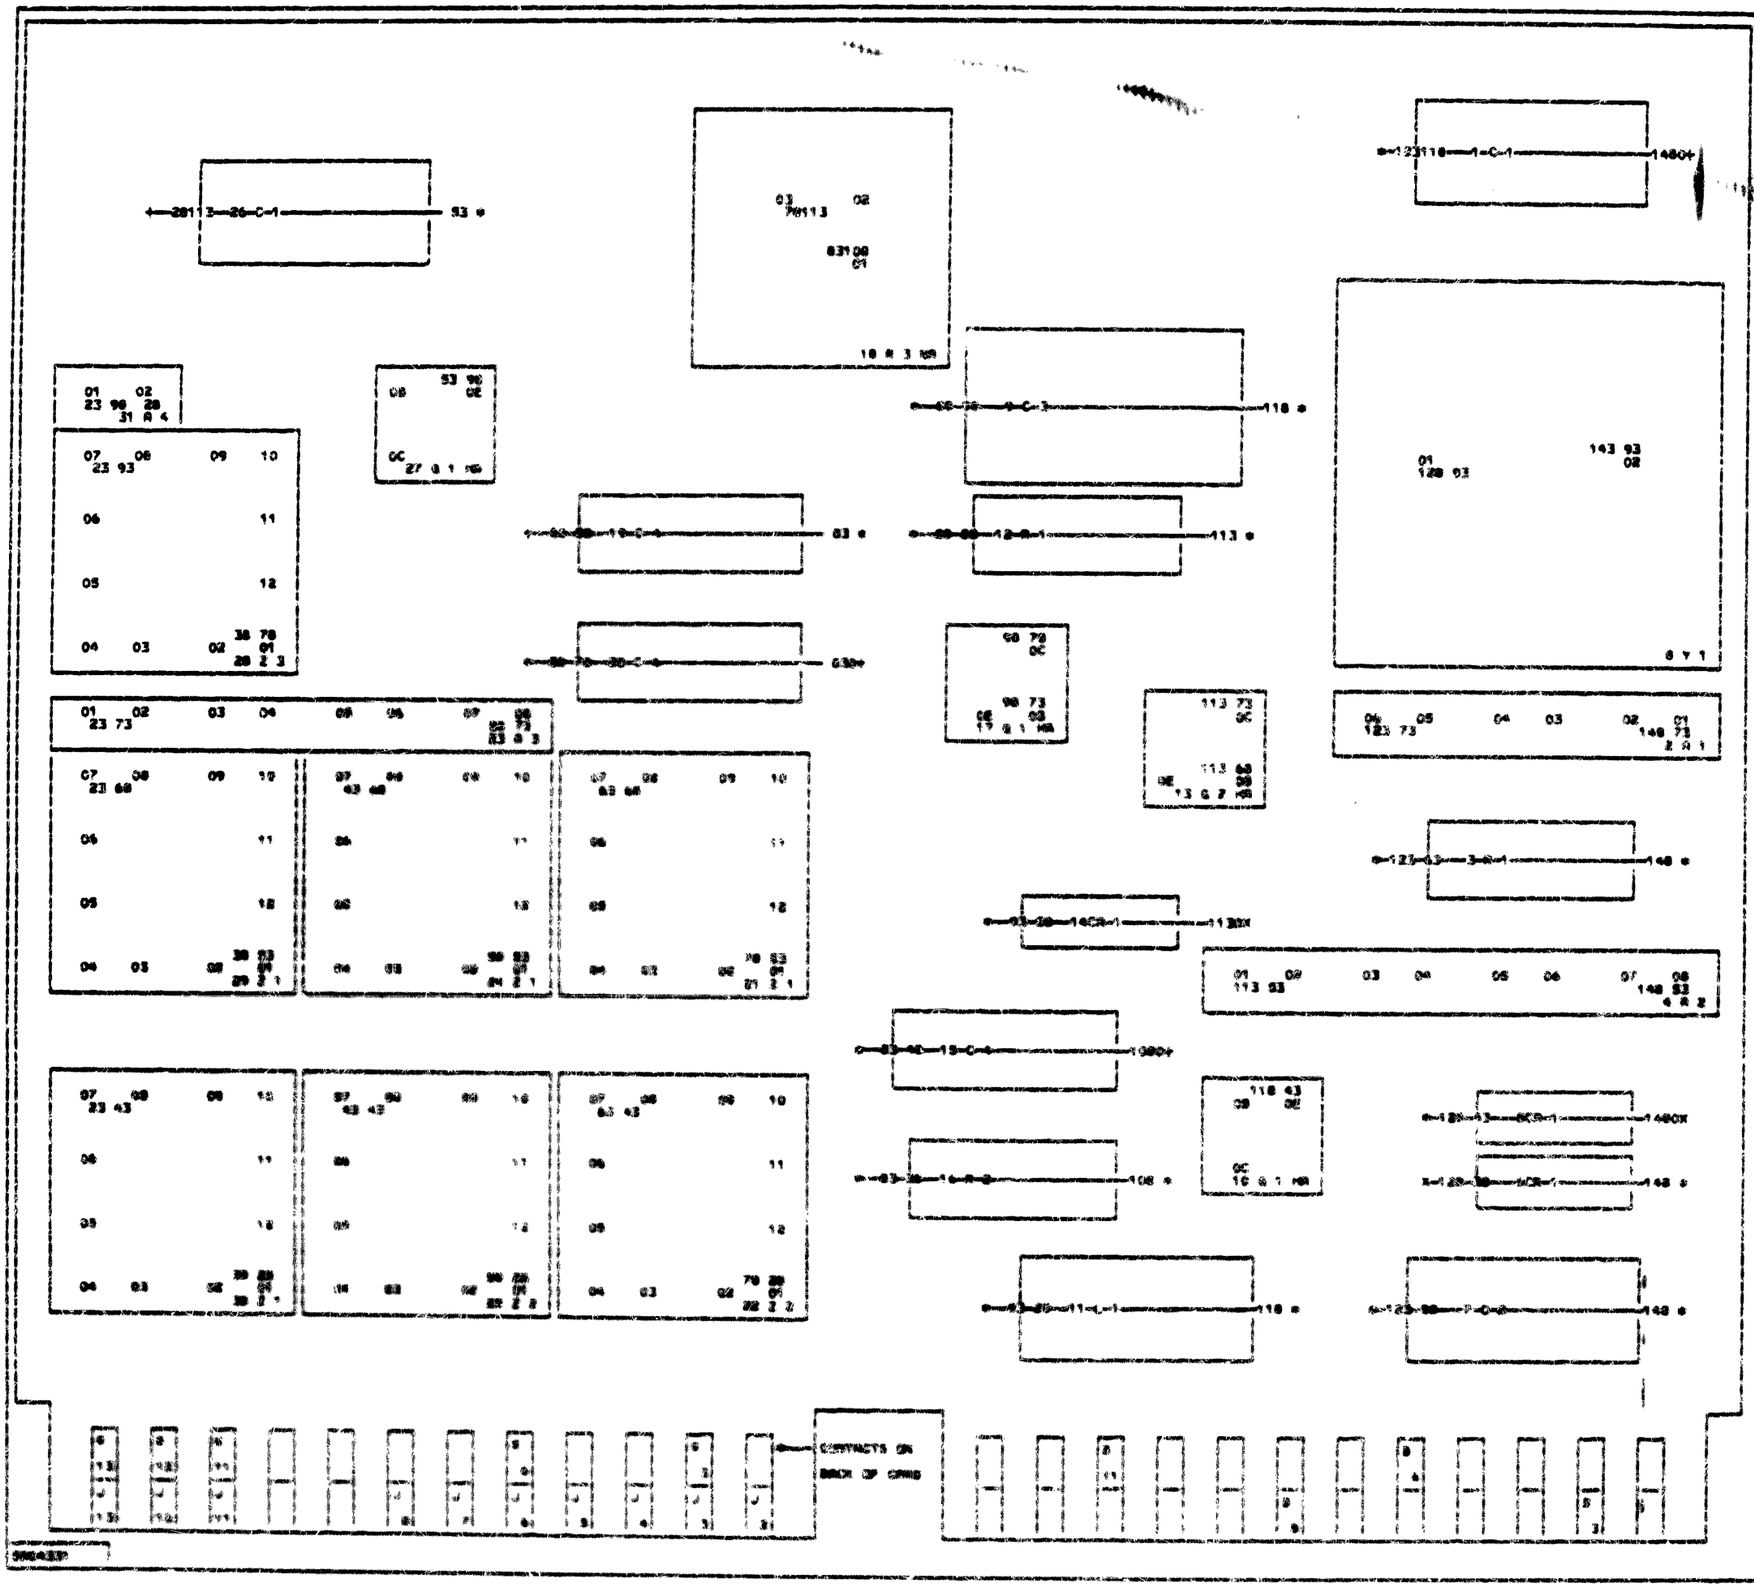


| PIN | VOLTS | PIN | VOLTS |
|---|---|---|---|
| J 8 | GND | J 3 | + 3 |
| D 8 | GND | D 3 | + 3 |
| G11 | + 6 | G 6 | - 3 |
| B11 | + 6 | B 6 | - 3 |

| CODE | PART NO | VALUE | QTY |
|---|---|---|---|
| R 1 | 580093 | 1.300K .12 + 1 | 2 |
| R 2 | 333202 | 240.000 .50 + 5 | 1 |
| R 3 | 492679 | 1.000K 1. + 5 | 1 |
| C 1 | 383608 | 6.2 U | 2 |
| C 2 | 280407 | 13. P | 1 |
| C 3 | 2109818 | 330. P | 1 |
| C 4 | 124582 | 1. U | 3 |
| CR 1 | 369117 | GD | 2 |
| Q 1 | 369126 | 048 NPN | 3 |
| Q 2 | 369587 | 152 NPN | 1 |
| L 1 | 217139 | 16. U | 1 |
| Y 1 | 2914850 | 2. M | 1 |
| Z 1 | 361491 | SLT MODULE | 4 |
| Z 2 | 361475 | SLT MODULE | 2 |
| Z 3 | 361473 | SLT MODULE | 1 |
| A 1 | 2390615 | RC MODULE | 1 |
| A 2 | 2390810 | RC MODULE | 1 |
| A 3 | 2390803 | RC MODULE | 1 |
| A 4 | 2390200 | RC MODULE | 1 |
| MA | 811157 | | 04 |

NOTES:

RA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.

RB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

RL-CARD HAS NOT BEEN DECOUPLED. 811800 IS NOT APPLICABLE.

RM-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
ADDITIONAL USAGE TO BE AVOIDED

RN-ASSEMBLE WITH P/N 811157 (TO-18) SPACER.

RR-PART MUST NOT BE SUBJECTED TO ANY LIQUID.

INTERNATIONAL BUSINESS MACHINES CORP.

| | | | | | |
|---|---|---|---|---|---|
| NAME | 2 MC OSCILLATOR. | | | | |
| DESIGN | 01-23-64 | LAN | TYPE | 2702 | |
| DETAIL | 02-12-64 | RBE | SCALE | NONE | |
| CHECK | 03-25-64 | RDH | DRAW | 7090 | 03-26-65 |
| BOARD | - - | | L.C.N. | | LAMINATED |