


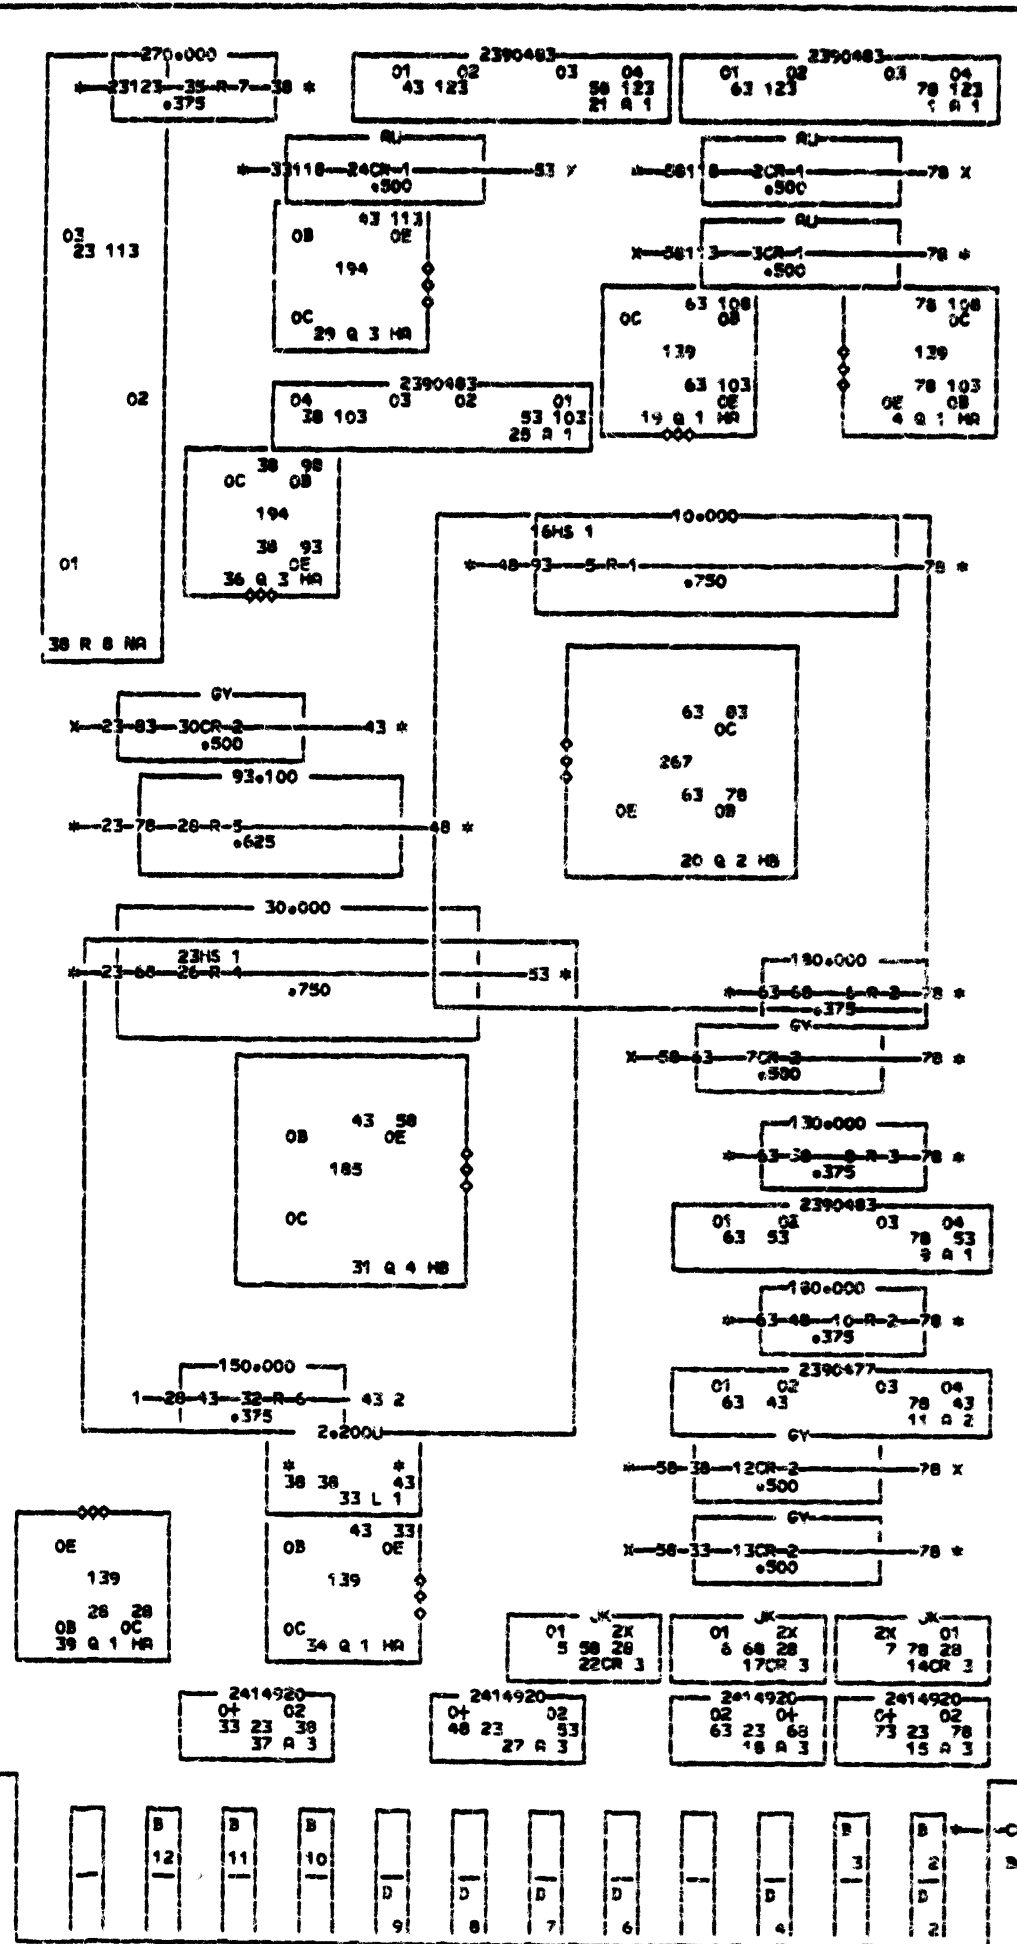

STANDARDS CODE	3-6235		SHEET 2 OF 3	5801425
CIRCUIT APPROVAL	WPL	06-06-68	STATUS	ACTIVE
LOCATION	BOLDER			RESTRICTED
RAW CARD NUMBER	5817934	3	HOLE PATTERN	5817934
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5817934	12-08-66	166243	A	18-20-67 166578 D
BACK ARTWORK	01-25-67	166554	B	03-02-67 166668 E
5817934	03-02-67	166561	C	06-10-68 166706 F

PIN	VOLT.
D04	+12
D07	-15
D08	GND
B11	+6

CODE	PART NO	VALUE	QTY
R 1	813245	10,000 2.00	+ 1
R 2	216431	180,000 .25	+ 5
R 3	217081	130,000 .25	+ 5
R 4	814156	30,000 3.00	+ 1
R 5	479039	93,100 .12	+ 1
R 6	216429	150,000 .25	+ 5
R 7	595358	270,000 .25	+ 5
R 8	2199306	1,000K 1.00	+ 10
CR 1	491300	RU	3
CR 2	2414891	GV	4
CR 3	2391058	JK	3
Q 1	2414938	139 DNP	4
Q 2	2390102	267 NPN	1
Q 3	2414818	194 NPN	2
Q 4	369693	185 NPN	1
L 1	2391006	2,200U	1
HS 1	813172	HEAT SINK	2
A 1	2390483	RC MODULE	4
A 2	2390477	RC MODULE	1
A 3	2414920	RC MODULE	4
FA			4
HA	811157	PTO-18- SPACER.	1
HB	811399	PTO-5- SPACER.	102

NOTES:
A-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
B-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
C-CARD HAS BEEN DECLASSIFIED BY 1800 IS NOT APPLICABLE.
D-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
E-ADDITIONAL USAGE TO BE AVOIDED
F-ASSEMBLE WITH PIN 811157 PTO-18- SPACER.
G-ASSEMBLE WITH PIN 811399 PTO-5- SPACER.
H-PART MUST NOT BE SUBMITTED TO ANY LIQUID.

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	SINK SOURCE			
DESIGN	11-16-66	CFC	TYPE	LSJ-2
DETAIL	11-16-66	LFC	SCALE	NONE
CHECK	11-18-66	APV	DRAW	17090 106-12-68
APPRO	12-08-66	GHI	L.C.N.	5801425 LAMINATED