

STANDARDS CODE	2-6235		SHEET 2 OF 5	5801458
CIRCUIT APPROVAL	PHS	05-26-67	STATUS	ACTIVE
LOCATION	POUGHKEEPSIE			RESTRICTED
RAW CARD NUMBER	5817979		HOLE PATTERN	5817979
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5817979	06-15-67	171484	A	
BACK ARTWORK	08-20-68	175336	B	
5817979	01-06-69	177187	C	

PIN	VOLT.
D 8	GND
D 3	+ 3
B 11	+ 6
B 6	- 3

CODE	PART NO	VALUE	QTY
R 1	216439	510.000 .25 + 5	1
R 2	5301519	30.000 .25 + 5	1
CR 1	369118	CE	5
CR 2	2414808	GGG	1
Q 1	2414811	193 NPN	1
Z 1	361438	SLT MODULE	5
A 1	2391002	RC MODULE	5
A 2	2390470	RC MODULE	5
A 3	2390598	RC MODULE	4
A 4	2414920	RC MODULE	3
A 5	2391037	RC MODULE	1
FA			3
HA	811157	PTO-18 ₁ SPACER.	101

NOTES.

AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.


AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.

FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.

ADDITIONAL USAGE TO BE AVOIDED

HA-ASSEMBLE WITH PIN 811157 PTO-18₁ SPACER.

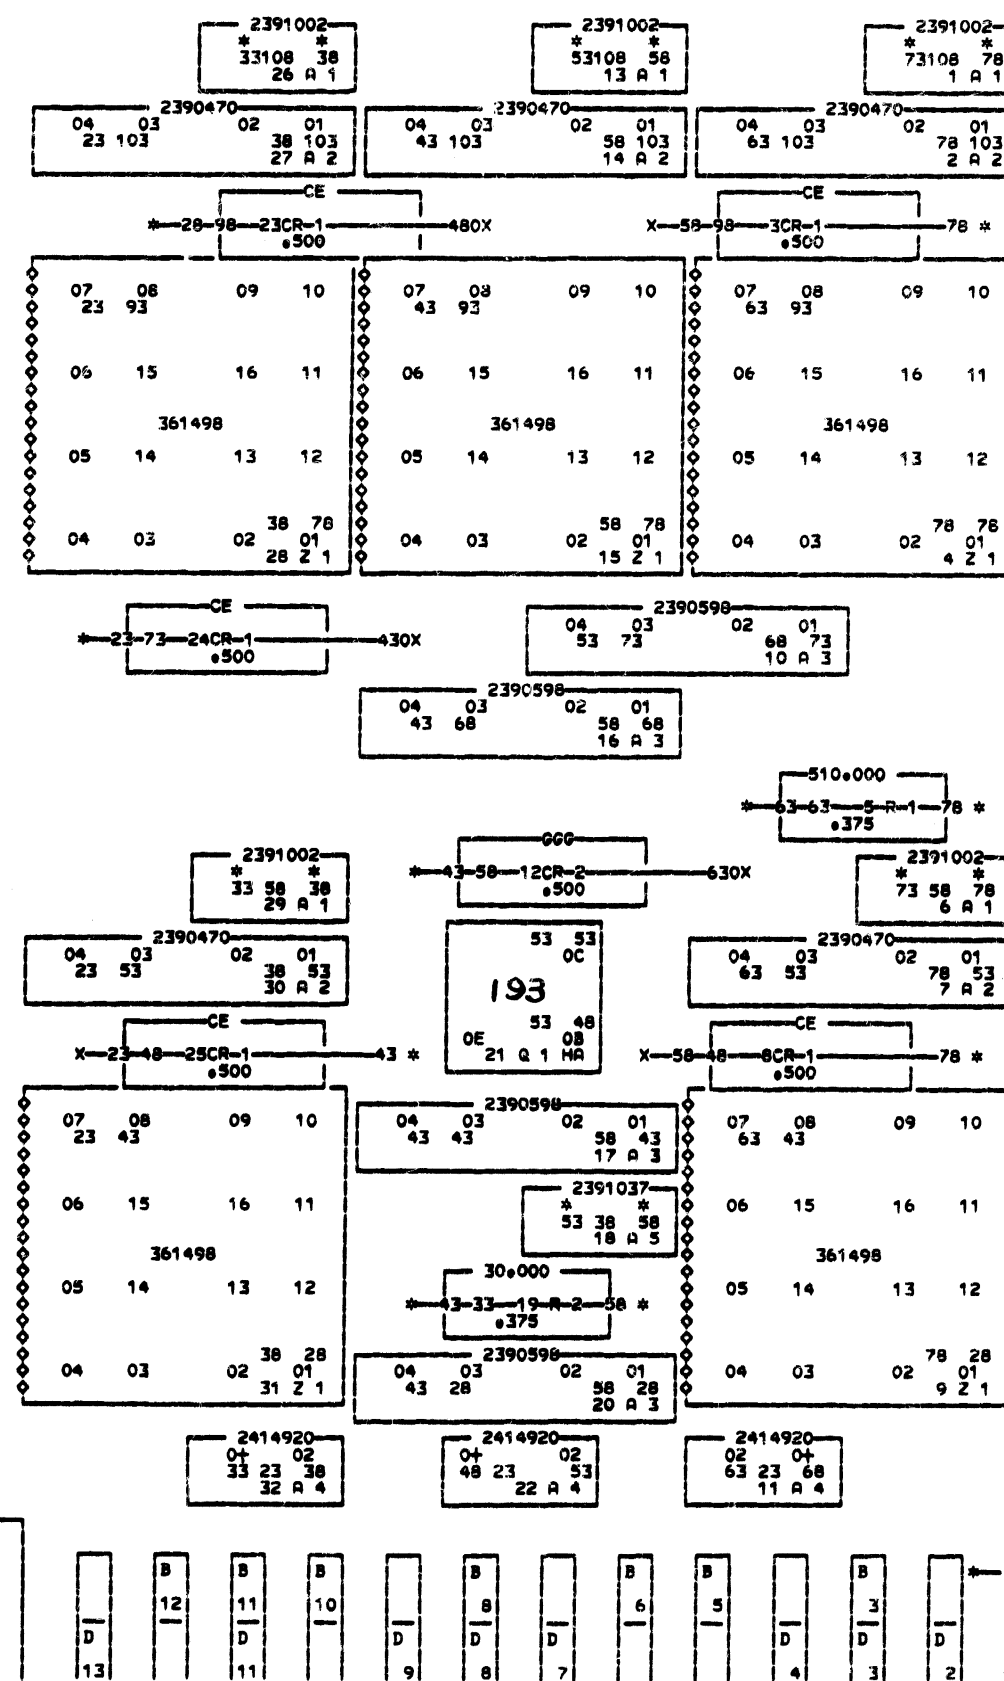

CONTACTS ON
BACK OF CARD

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	COUPLER RECEIVER SLT			
DESIGN	05-26-67	ME	TYPE	MOD 85
DETAIL	05-26-67	WM	SCALE	NONE
CHECK	05-26-67	WM	DRAW	17090 12-03-68
APPRO	05-26-67	PHS	L.C.N.	5801458B LAMINATED