


STANDARD CODE	2-7045		SHEET 2 OF 3	5804289
CIRCUIT APPROVAL	AL	09-08-65	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	SB17018	1	HOLE PATTERN	SB17018
FRONT NETWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
SB17018	10-21-64	161691		
BACK NETWORK	06-30-65	164806	2	
SB17018	01-31-66	165525	C	

PIN	VOLT.
311	+05
308	000
306	-03
303	-03

CODE	PART NO.	VALUE	QTY
R 1	216443	750,000 $\pm 5\%$	3
R 2	216454	2,400K $\pm 5\%$	3
R 3	216430	160,000 $\pm 5\%$	3
R 4	334927	39,000 $\pm 5\%$	3
Q 1	533441	026 PNP	3
Q 2	2391197	134 PNP	3
HS 1	813166	HEAT SINK	3
Z 1	361497	SLT MODULE	1
A 1	2414920	RC MODULE	3
FZ	814006		3
FZ	812165		3
FZ	438541		6
PC			3
HB	811399		03

NOTES:

- AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
- AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
- FZ-PLACE TRANSISTOR THRU MOUNTING HOLES OF HEAT SINK AND INSULATOR P/N 814006 SO THAT LEADS ARE CENTERED. MOUNT COMPLETE ASSEMBLY TO CARD USING CAP P/N 813165 AND SCREWS P/N 438541 INSERTED FROM BACK OF CARD. DO NOT SUBJECT TO LIQUIDS. DUE TO COMPONENT HEIGHT OF .370 TO .460 THIS CARD MUST BE REMOVED PRIOR TO REMOVAL OF CARD ADJACENT TO COMPONENT SIZE.
- AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.
- FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL. ADDITIONAL USAGE TO BE AVOIDED
- HB-ASSEMBLE WITH P/N 811399 T0-51 SPACER.

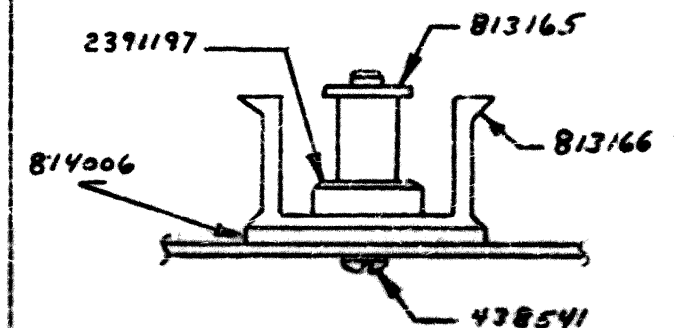

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	1	AMP PNP DRIVER		
DESIGN	10-08-65	P/N	TYPE	RPCR
DETAIL	10-08-65	P/N	SCALE	NONE
CHECK	09-14-65	JEB	3000	7090 01-19-66
APPRO	09-14-65	SRS	LoCo	

