


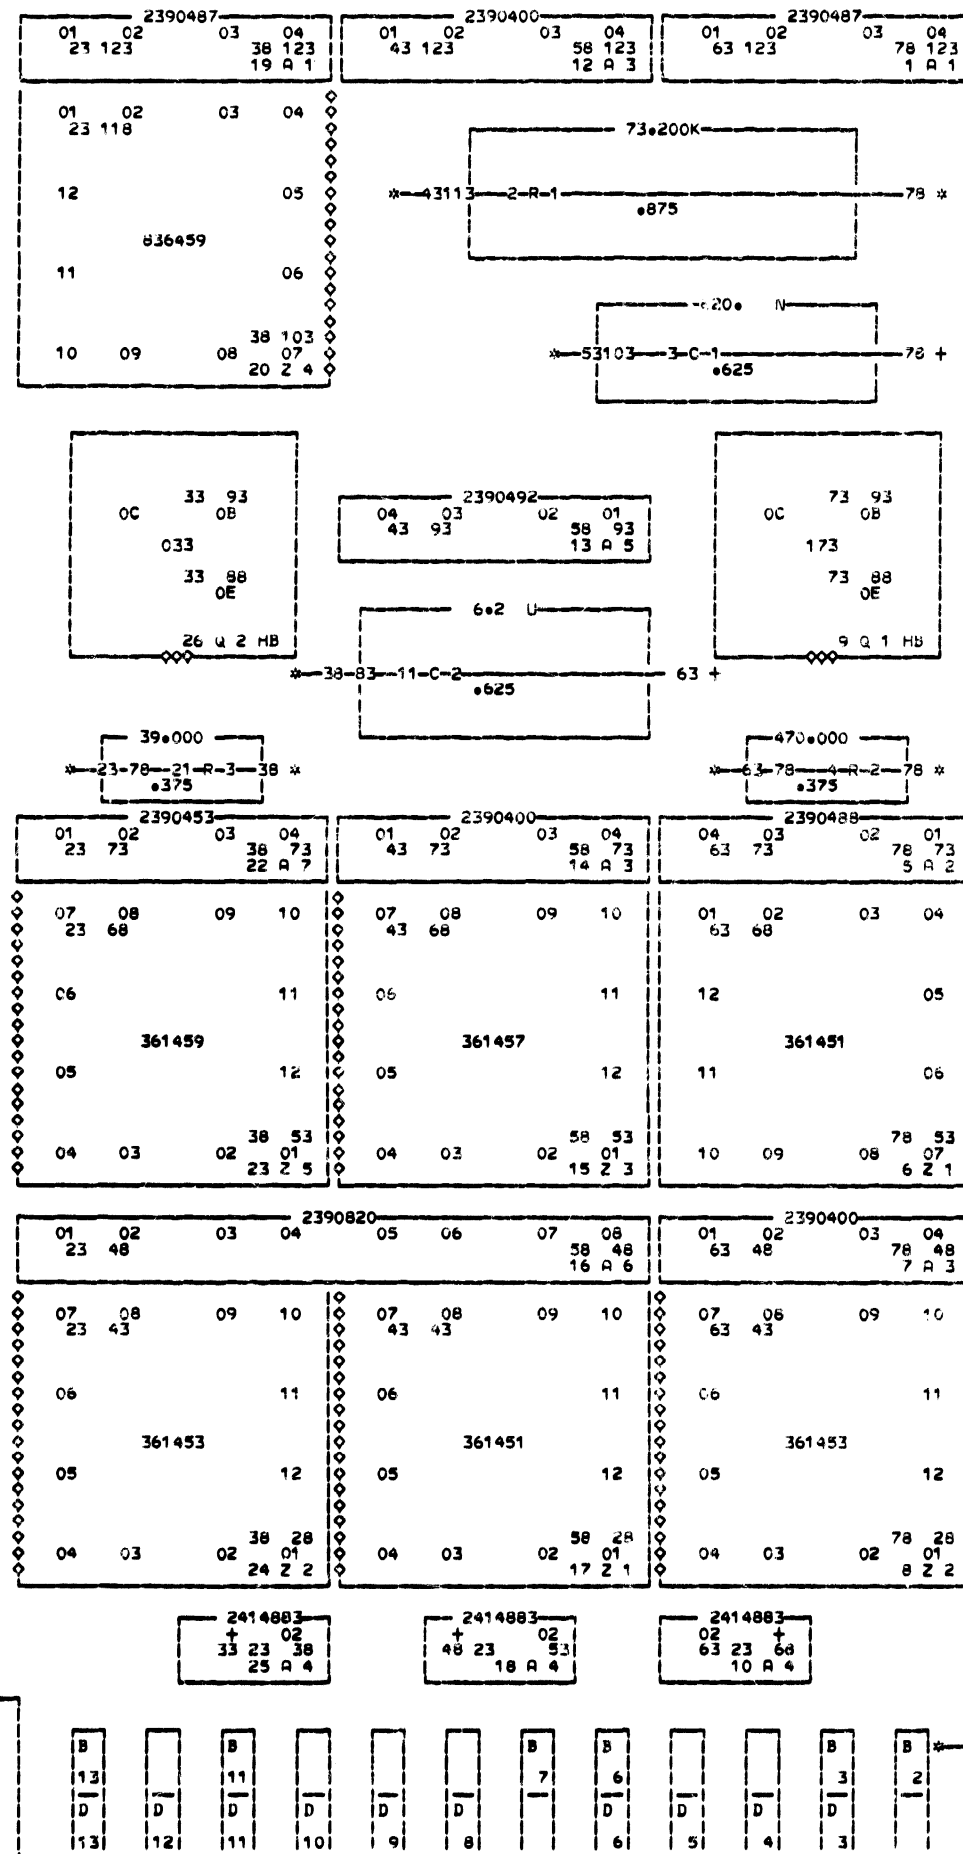

|                  |          |              |                      |
|------------------|----------|--------------|----------------------|
| STANDARDS CODE   | 2-6235   | SHEET 2 OF 3 | 5803356              |
| CIRCUIT APPROVAL | PEM      | 08-27-64     | STATUS ACTIVE        |
| LOCATION         | KINGSTON |              | RESTRICTED           |
| RAW CARD NUMBER  | 5815341  | 2            | HOLE PATTERN 5815341 |
| FRONT ARTWORK    | DATE     | CHANGE NO.   | DATE                 |
| 5815341          | 04-10-64 | 160187       |                      |
| BACK ARTWORK     | 09-14-64 | 161535       |                      |
| 5815341          | 09-04-67 | 171763       | IC                   |

| PIN | VOLT. |
|-----|-------|
| D 8 | 0V    |
| D 3 | + 3   |
| B11 | + 6   |
| B 6 | - 3   |

| CODE | PART NO | VALUE         | QTY    |
|------|---------|---------------|--------|
| R 1  | 482134  | 73*200K       | 25 + 1 |
| R 2  | 216438  | 470*000       | 25 + 5 |
| R 3  | 5301510 | 39*000        | 25 + 5 |
| C 1  | 222062  | 820           | 1      |
| C 2  | 483330  | 6*2           | 1      |
| Q 1  | 369624  | 173 NPN       | 1      |
| Q 2  | 318324  | 1033 PNP      | 1      |
| Z 1  | 361451  | SLT MODULE    | 2      |
| Z 2  | 361453  | SLT MODULE    | 2      |
| Z 3  | 361457  | SLT MODULE    | 1      |
| Z 4  | 836459  | SLT MODULE    | 1      |
| Z 5  | 361459  | SLT MODULE    | 1      |
| A 1  | 2390487 | RC MODULE     | 2      |
| A 2  | 2390488 | RC MODULE     | 1      |
| A 3  | 2390400 | RC MODULE     | 3      |
| A 4  | 2414883 | RC MODULE     | 3      |
| A 5  | 2390492 | RC MODULE     | 1      |
| A 6  | 2390820 | RC MODULE     | 1      |
| A 7  | 2390453 | RC MODULE     | 1      |
| FA   |         |               | 1      |
| HB   | 811399  | PTO-54 SPACER | 102    |

#### NOTES.

- AA-ALL CIRCUITS MUST CONFORM TO ENG.SPEC. SHOWN ON SHEET 1.
- AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890313
- AK-CARD HAS BEEN DECOUPLED 311800 IS NOT APPLICABLE.
- FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
- ADDITIONAL USAGE TO BE AVOIDED
- HB-ASSEMBLE WITH PIN 811399 PTO-54 SPACER.

| INTERNATIONAL BUSINESS MACHINES CORP. |                                  |     |       |           |
|---------------------------------------|----------------------------------|-----|-------|-----------|
| NAME                                  | CARD ASSEMBLY-ELAPSED TIME METER |     |       |           |
|                                       | LAB                              |     |       |           |
| DESIGN                                | 01-21-64                         | CDA | TYPE  | 2060      |
| DETAIL                                | 01-21-64                         | CDA | SCALE | NONE      |
| CHECK                                 | 03-02-64                         | WMM | DRAW  | 7090      |
| APPRO                                 | 08-27-64                         | PEM | LOC'D | LAMINATED |