


STANDARD CODE	2-7045		SHEET 2 OF 3	5001109
CIRCUIT APPROVAL	JES	07-26-65	STATUS	ACTIVE
LOCATION	KIRKSTON			RESTRICTED
RAW CARD NUMBER	5016100	2	HOLE PATTERN	5016100
PRINT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5016100	08-09-65	164260	A	
BACK ARTWORK				
5016100				

PIN	VAL.
D03	+ 3
D11	+ 6
D06	- 3
D05	-36
J05	-36
D08	0ND
J08	0ND

CODE	PART NO.	VALUE	QTY
R 1	3501064	4.750K	010 + 1 1
R 2	3501787	13.700K	010 + 1 1
R 3	3127157	1.500K	025 + 5 1
R 4	3501753	5.100K	050 + 5 2
R 5	3506107	3.000K	025 + 5 1
R 6	3501310	499.000K	012 + 1 1
R 7	3506114	100.000K	025 + 5 1
R 8	3501451	3.320K	010 + 1 1
R 9	3501096	1.000K	010 + 1 1
R10	3501480	2.610K	010 + 1 1
R11	3506072	10.000K	025 + 5 1
R12	3501159	7.870K	010 + 1 1
R13	3127447	3.300K	025 + 5 1
R14	3501453	100.000K	010 + 1 1
C 1	3501311	10. U	1
CR 1	3501932	YF	2
Q 1	3501080	800	2
Q 2	3501675	824	2
Z 1	361473	SLT MODULE	1
A 1	2414883	RC MODULE	6
A 2	2414961	RC MODULE	1
HA	011157		02
HB	011399		02

NOTES:
 RA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
 RB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
 RC-CARD HAS BEEN DECOUPLED 011000 IS NOT APPLICABLE.
 PD-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
 RE-ADDITIONAL USAGE TO BE ADVISED
 HA-ASSEMBLE WITH P/N 011157 (T0-10) SPACER.
 HB-ASSEMBLE WITH P/N 011399 (T0-6) SPACER.

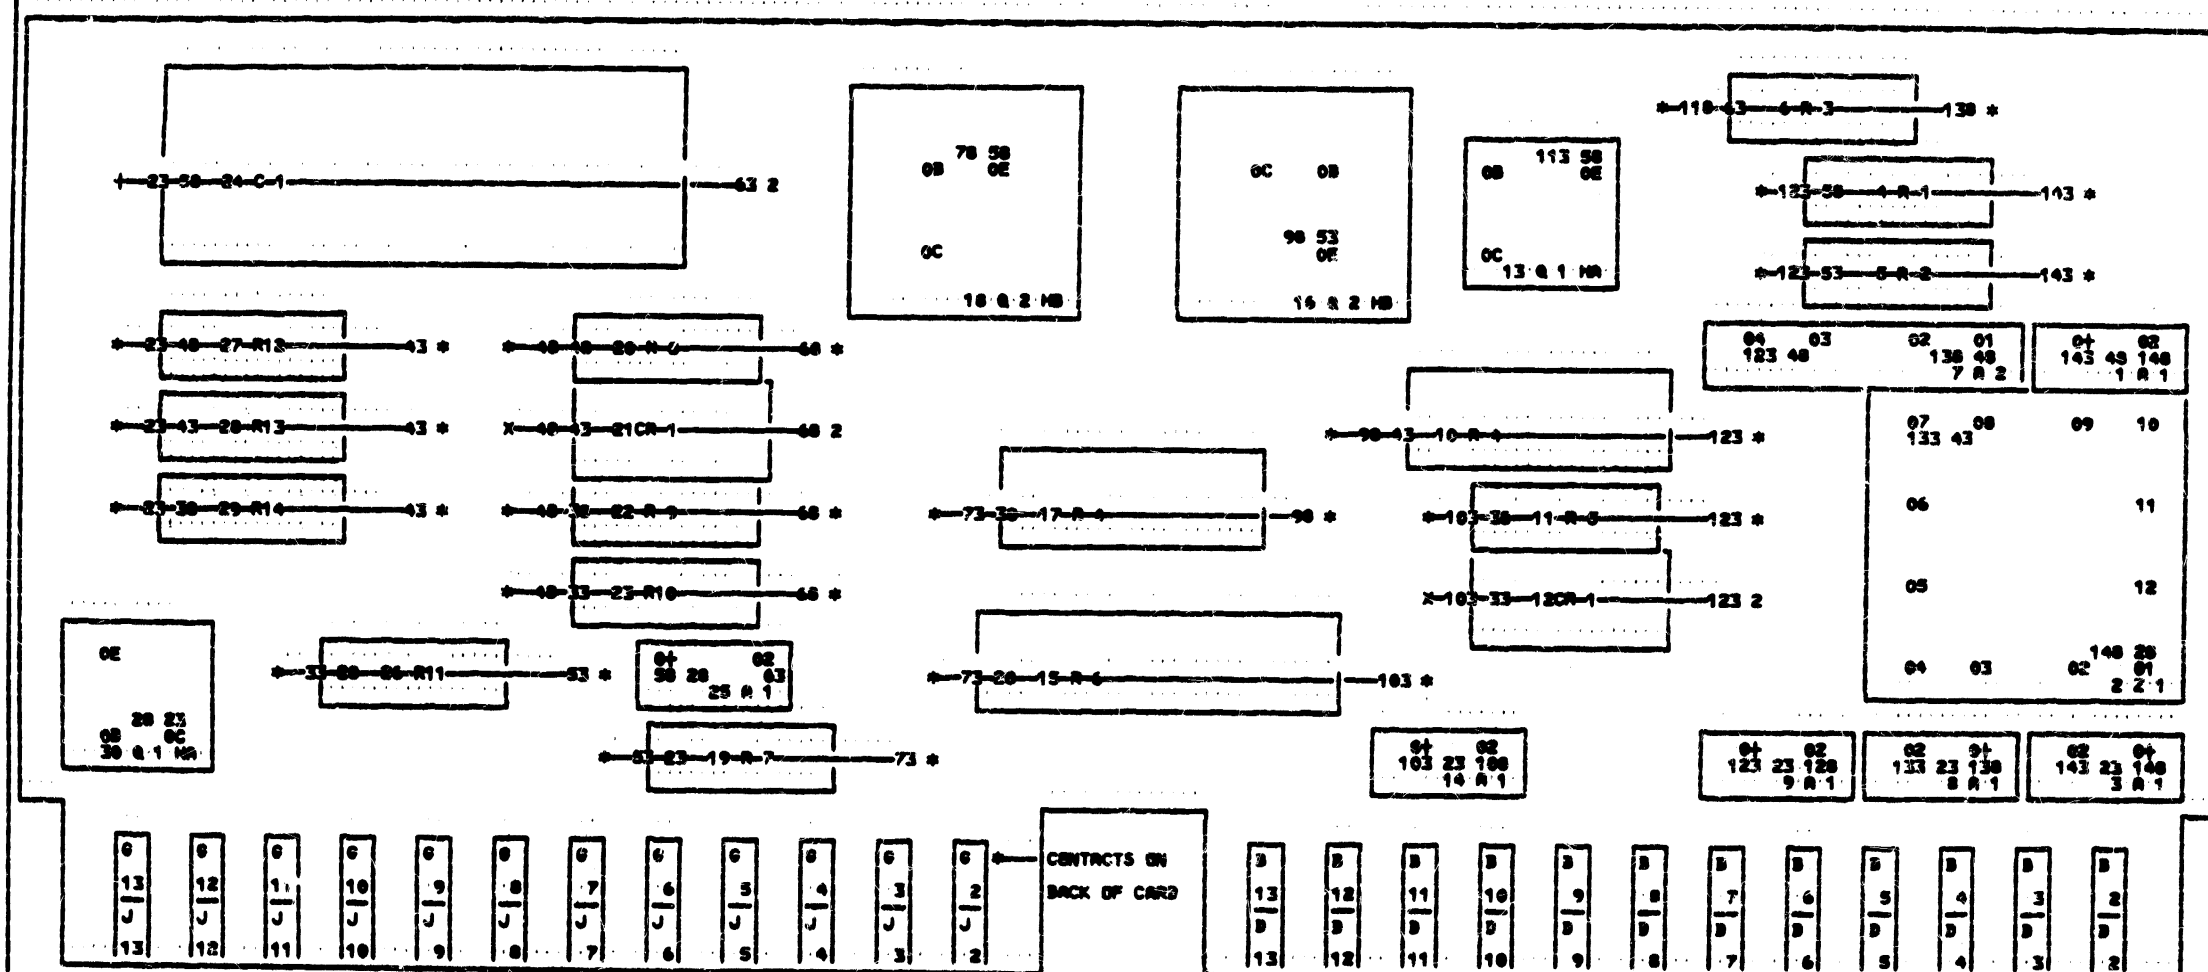

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	CARD RSR-15 SECOND DELAY			
DESIGN	08-17-65	NIS	TYPE	1311REL
DETAIL	08-17-65	NIS	SCALE	NONE
CHECK	07-20-65	DS	DRW	7050 08-19-65
APPRO	07-20-65	JES	L.C.No.	