


STANDARDS CODE	2-7045			5801177
CIRCUIT APPROVAL	IE	08-07-64	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	5816799	1	HOLE PATTERN	5816799
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5816799	04-27-64	DEV2752		
BACK ARTWORK	09-23-64	161252		
5816799				

PIN	VOLTY
B11	+06
006	-03
010	-36
D03	+03
D08	GR
J03	+03
J08	GR

CODE	PART NO	VALUE	QTY
R 1	492445	26.700K	.12 + 1 2
R 2	492493	1.780K	.12 + 1 4
R 3	479111	1.370K	.12 + 1 2
R 4	550093	1.300K	.12 + 1 2
R 5	492419	2.490K	.12 + 1 2
C 1	217028	3.9 N	2
CR 1	369117	CD	2
Z 1	361457	SLT MODULE	2
Z 2	361454	SLT MODULE	1
A 1	2390842	RC MODULE	1

NOTES.

- AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
- AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
- AL-CARD HAS NOT BEEN DECOUPLED 611800 IS NOT APPLICABLE.
- PA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
- ADDITIONAL USAGE TO BE AVOIDED

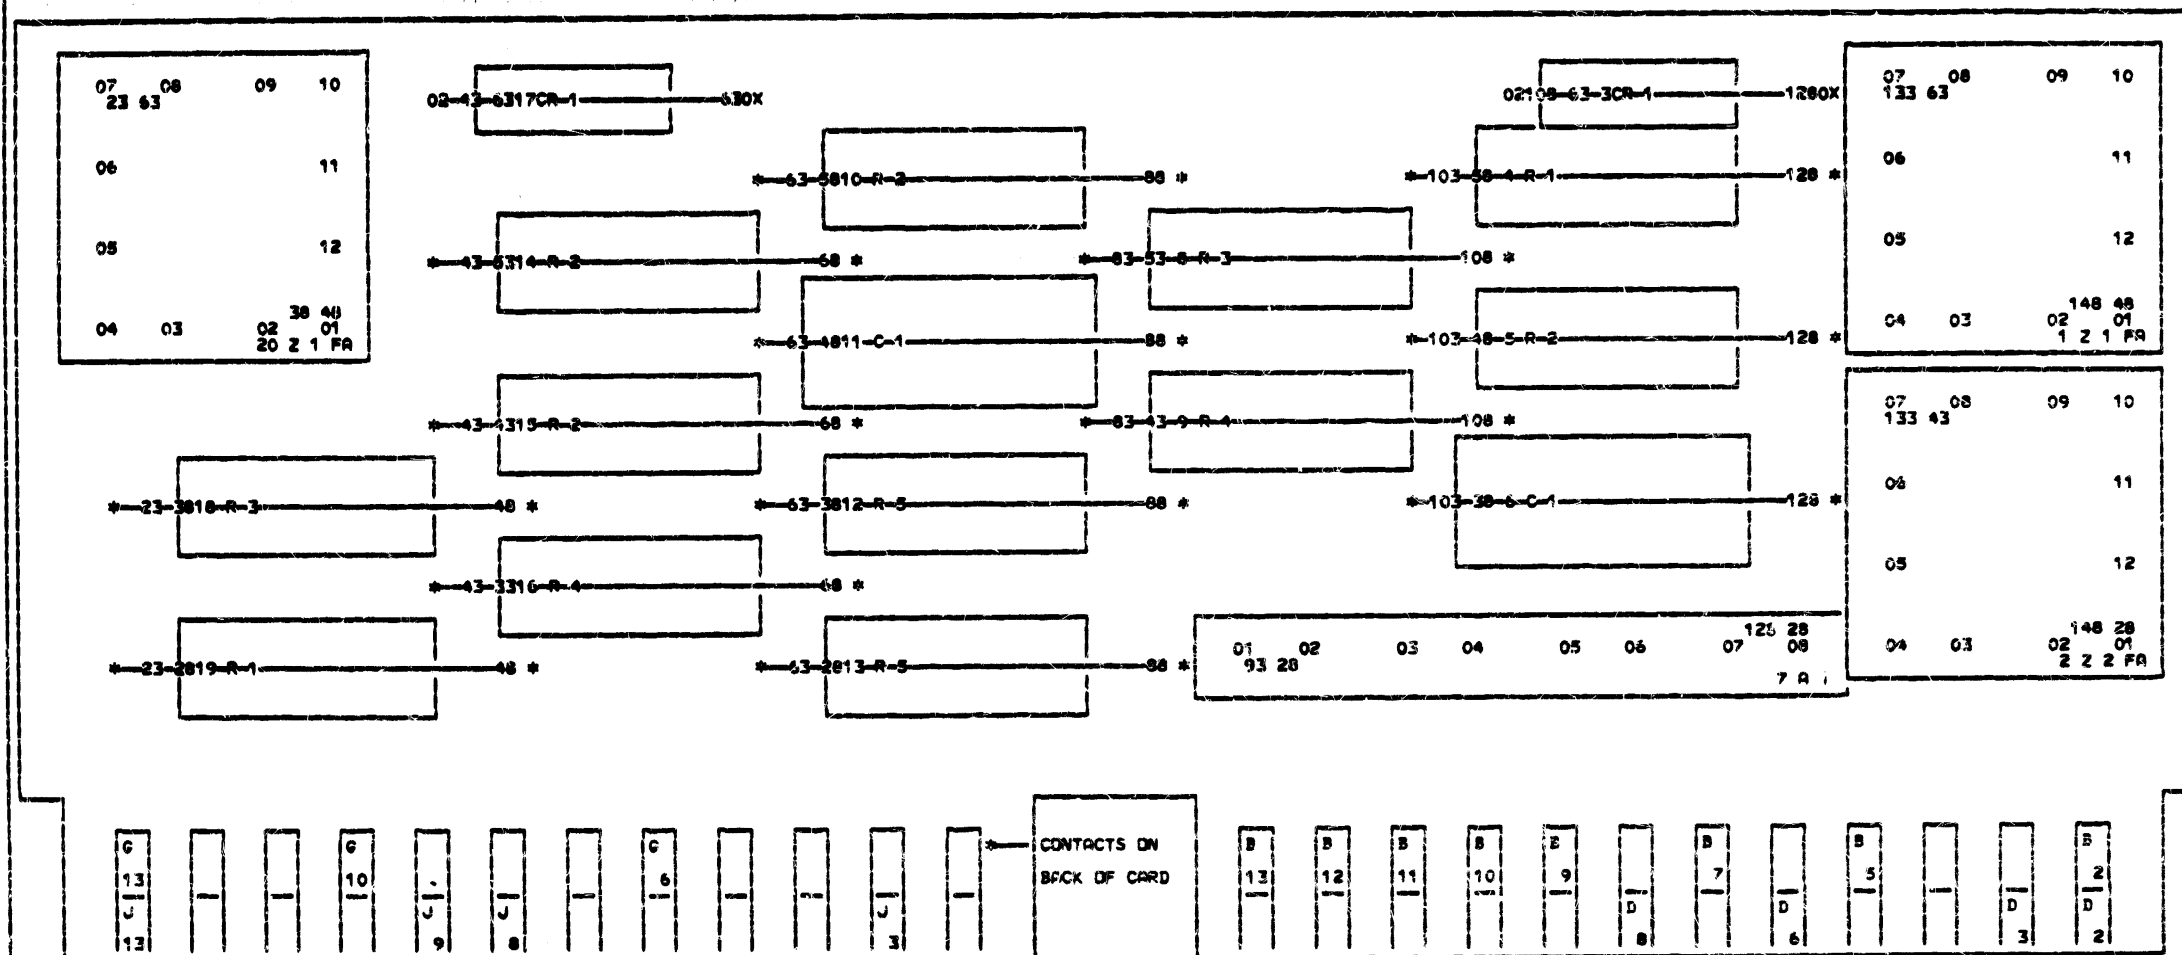

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	INDEX PULSE AMPLIFIER			
DESIGN	09-12-64	TH	TYPE	2321
DETAIL	09-12-64	TH	SCALE	NONE
CHECK	09-14-64	RT	DRAW	7030 09-04-64
APPRO	09-14-64	SAS	SHEET	2 OF 3