


STANDARDS CODE	2-7045		SHEET 2 OF 3	5801189
CIRCUIT APPROVAL	RJE	12-02-65	STATUS	ACTIVE
LOCATION	ROCHESTER			RESTRICTED
RAW CARD NUMBER	5815598	2	HOLE PATTERN	5815598
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5815598	01-17-64	DEV2341	12-09-65	164072
BACK ARTWORK	3-31-64	160229		
5815598	03-11-65	163332	18	

PIN	VOLT.
011	+12
008	-04
806	-03

CODE	PART NO	VALUE	QTY
A 1	216447	1.200K	25 + 5
A 1	492452	035 PNP	6
Z 1	361499	SLT MODULE	1
A 1	2390652	RC MODULE	2
A 2	2414905	RC MODULE	6
A 3	2390445	RC MODULE	2
A 4	2414983	RC MODULE	1
FA			6
HB	811399		06

NOTES:

- AG-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
- AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
- AG-CARD CONFORMS TO DECOUPLING REQUIREMENTS IN 811800.
- FA-TECH LAB EVALUATION INCOMPLETE; PART SUBJECT TO WITHDRAWAL.
- ADDITIONAL USAGE TO BE AVOIDED
- HB-ASSEMBLE WITH PIN 811399 PTO-54 SPACER.

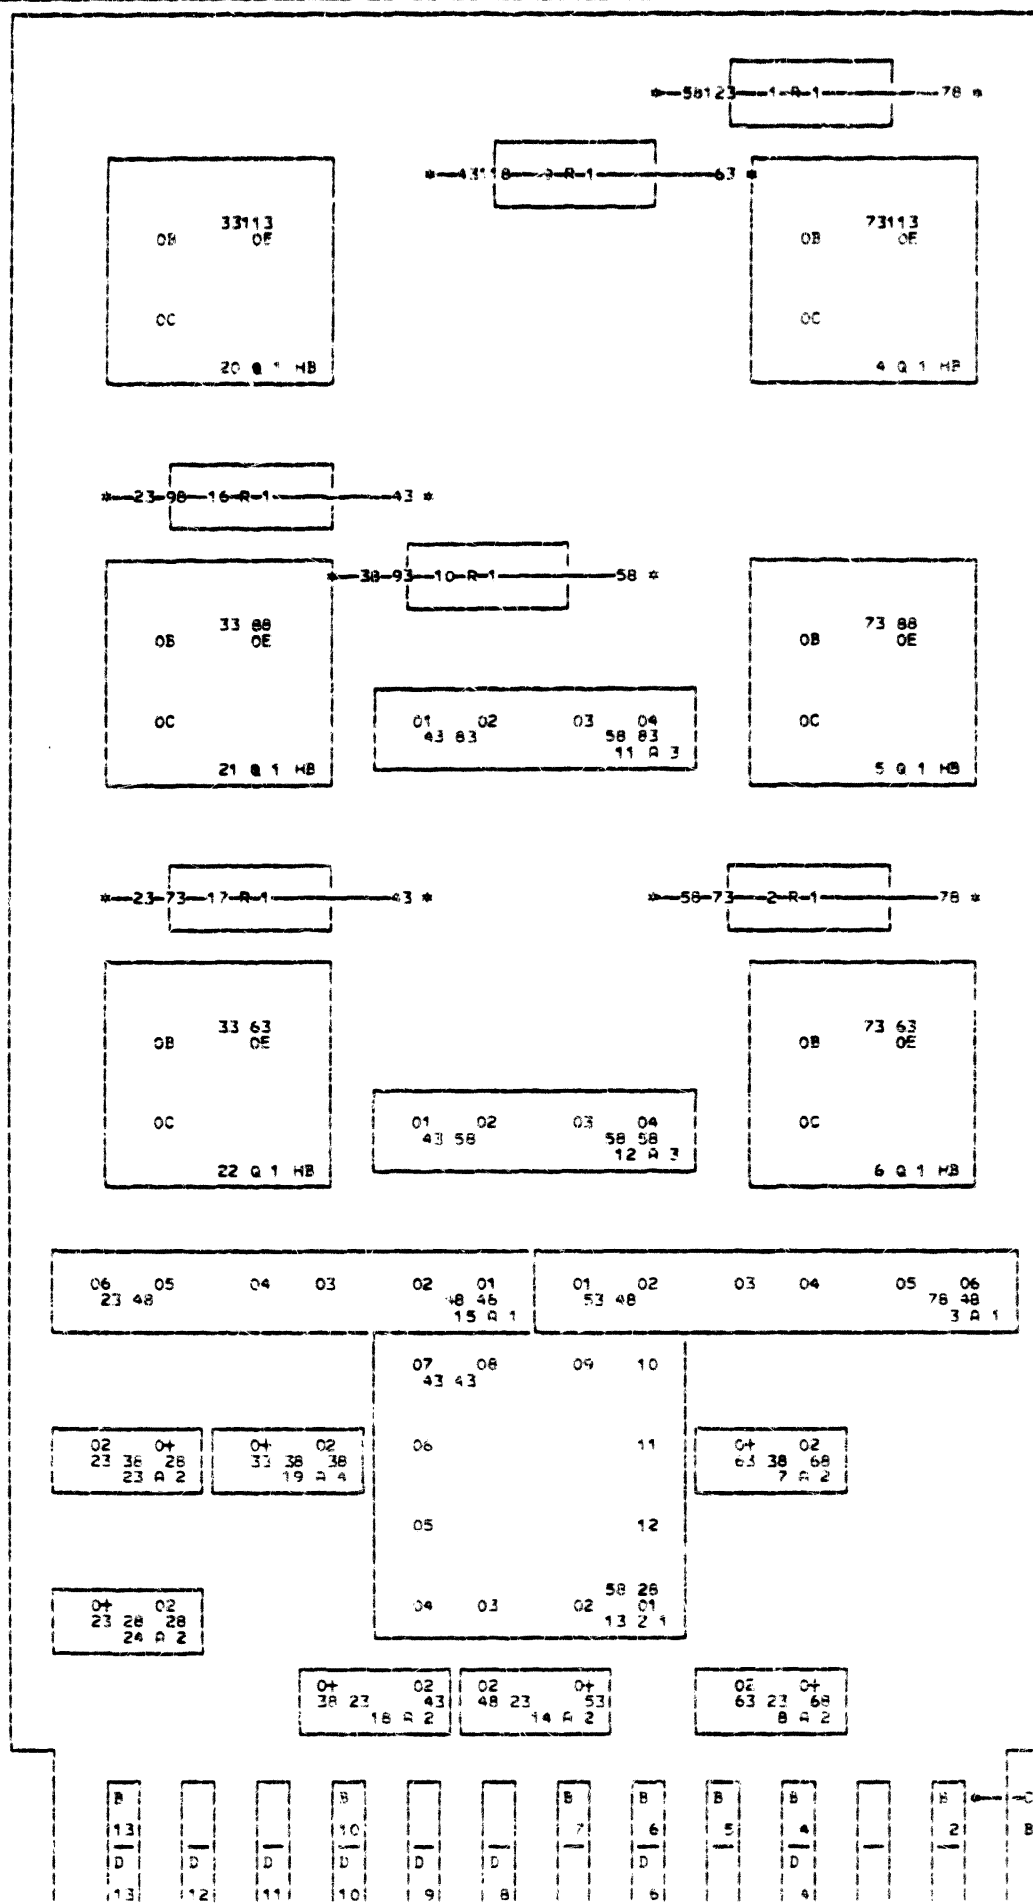

CONTACTS ON
BACK OF CARD

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	PUNCH DETECTOR			
DESIGN	12-02-65	DES	TYPE	1442
DETAIL	12-08-65	DES	SCALE	NONE
CHECK	12-09-65	SNS	DATE	17090
APPRO	-	-	LOC	02-07-66