


STANDARDS CODE	2-7045		SHEET 2 OF 3	5801349
CIRCUIT APPROVAL	DR	03-26-65	STATUS	ACTIVE
LOCATION	SAN JOSE			RESTRICTED
RAW CARD NUMBER	5819376	2	HOLE PATTERN	5819376
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5819376	09-30-64	161267		
BACK ARTWORK	05-10-65	164220	3	
5819376				

PIN	VOLTS
B07	-12
D08	GND
J03	+12
J06	GND

CODE	PART NO	VALUE	QTY
R 1	2163443	147.000K ±25 ±5	2
R 2	491276	1.620K ±2 ±1	1
R 3	479153	7.500K ±12 ±1	2
R 4	478970	16.200 ±12 ±1	1
R 5	216787	6.800P ±25 ±5	1
R 6	5052731	20.000K ±75 ±5	1
C 1	5052754	3.300N	1
C 2	5052755	4.700N	1
Z 1	361497	SLT MODULE	3
A 1	2390467	RC MODULE	1
A 2	2414908	RC MODULE	3
A 3	2390500	RC MODULE	1
A 4	2390600	RC MODULE	1

NOTES:
AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.
FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
ADDITIONAL USAGE TO BE AVOIDED
FB-CARD REQUIRES 1.250 SPACING ON FRONT SIDE.
NA-PART MUST NOT BE SUBJECTED TO ANY LIQUID.

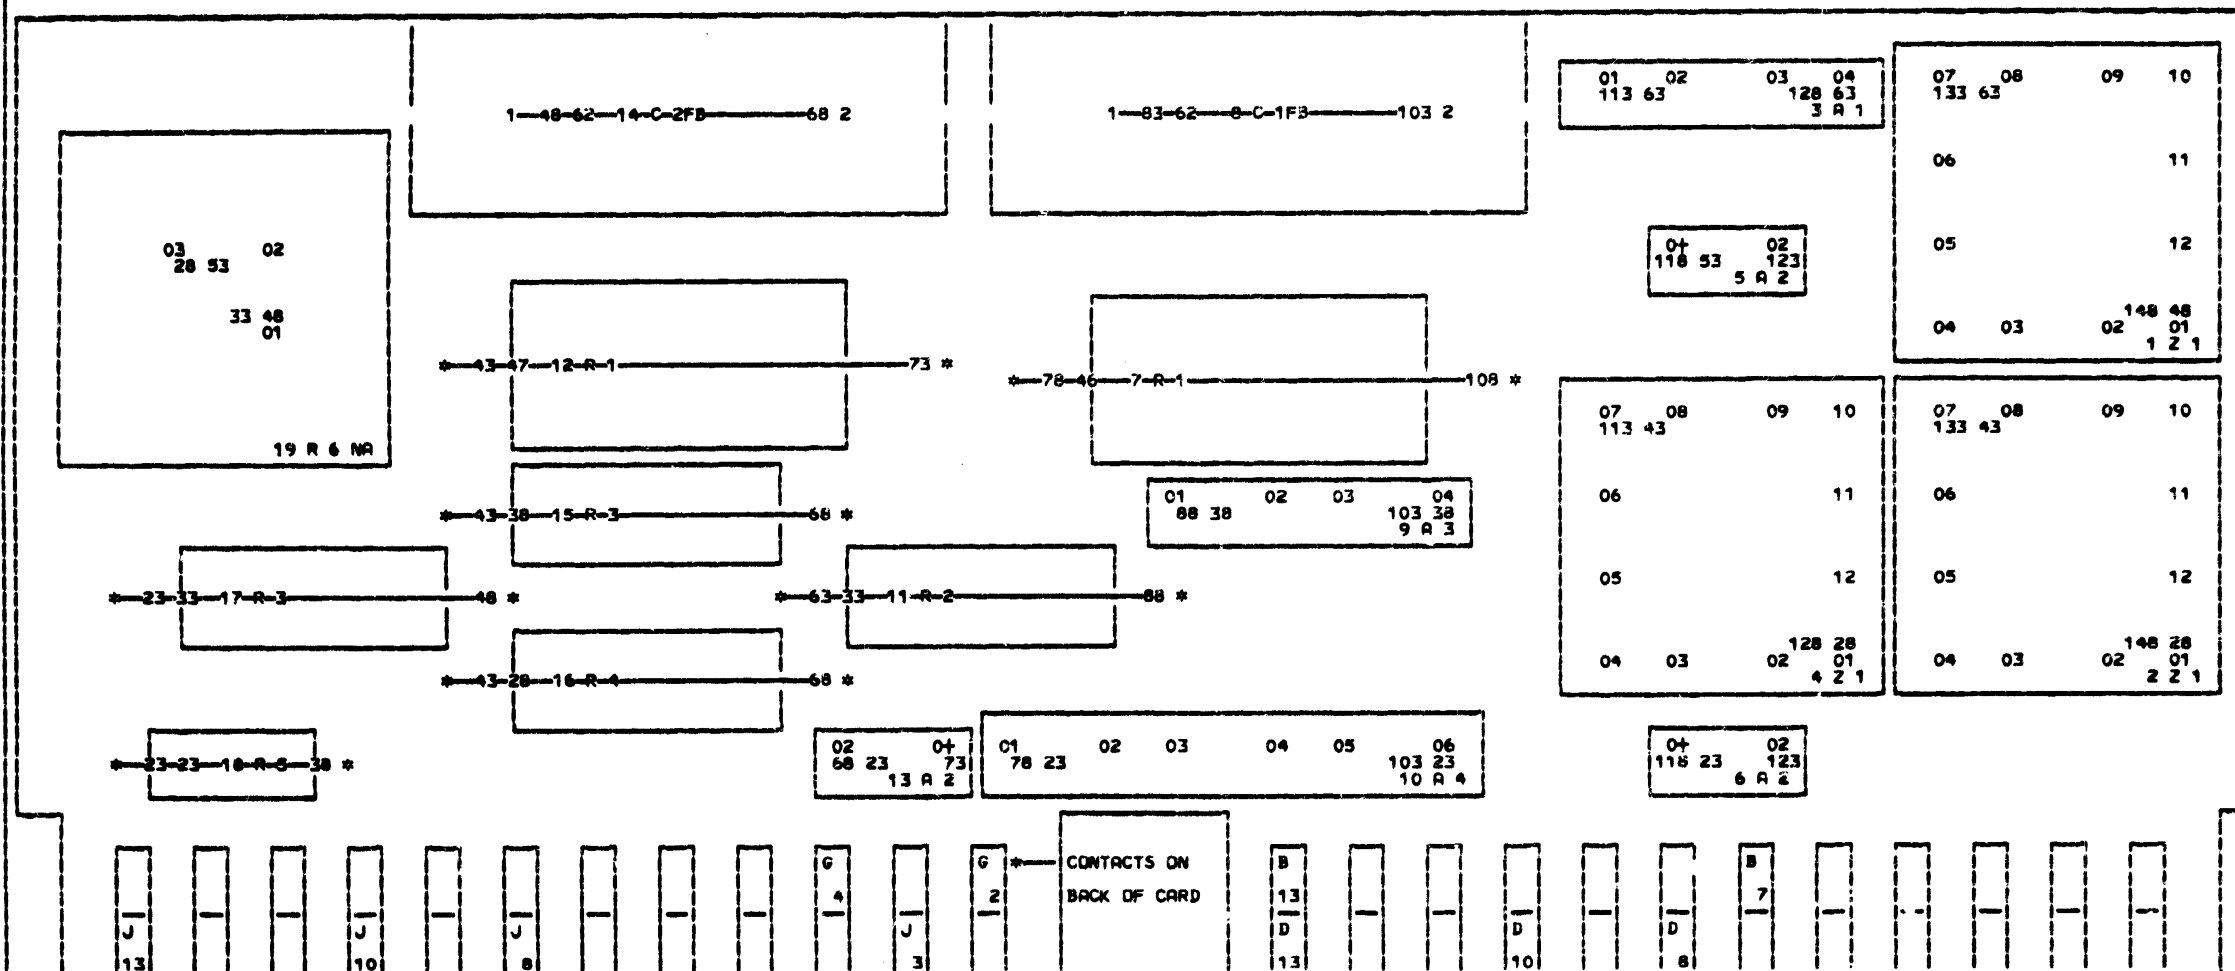

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	C-5 PERCENT 1200 CPS OSCILLATOR			
R				
DESIGN	06-07-65	TEM	TYPE	1070
DETAIL	06-07-65	TEM	SCALE	NONE
CHECK	06-07-65	RTT	DRW	7090
APPRO	06-11-65	SAS	LoCoNo	06-09-65