

STANDARDS CODE	2-6235		SHEET 2 OF 4	5801452
CIRCUIT APPROVAL	HMS	12-11-67	STATUS	ACTIVE
LOCATION	SAN JOSE		RESTRICTED	
RAW CARD NUMBER	5817969	1	HOLE PATTERN	5817969
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5817969	05-25-67	169748	12	
BACK ARTWORK	12-29-67	173100	B	
5817969				

PIN	VOLT.
D 8	GND
D 3	+ 3
B 11	+ 6
B 6	- 3

CODE	PART NO	VALUE	QTY
R 1	335131	100.000 1.00 + 5	1
R 2	216445	1.000K .25 + 5	1
C 1	133863	12. U	2
CR 1	2111232	AM	2
Q 1	369689	181 NPN	1
Z 1	361497	SLT MODULE	2
Z 2	361597	SLT MODULE	1
A 1	2390540	RC MODULE	1
A 2	2390507	RC MODULE	1
A 3	2390676	RC MODULE	1
A 4	2414883	RC MODULE	3
A 5	2390779	RC MODULE	1
RR 1	766061	NO-02 NO-02	1
FN	815198		12
HS	815192		101

NOTES:


AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913

AK-CARD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.

AW-CONTACTS PIN 815198 TO BE INSERTED BEFORE LIQUID PROCESS PER
ENG. SPEC. 8711830 REED RELAY ASSEMBLY TO BE HAND MOUNTED ON
CONTACTS AFTER LIQUID PROCESS.

HS-ASSEMBLE WITH PIN 815192 PTO-18: INSULATING SPACER

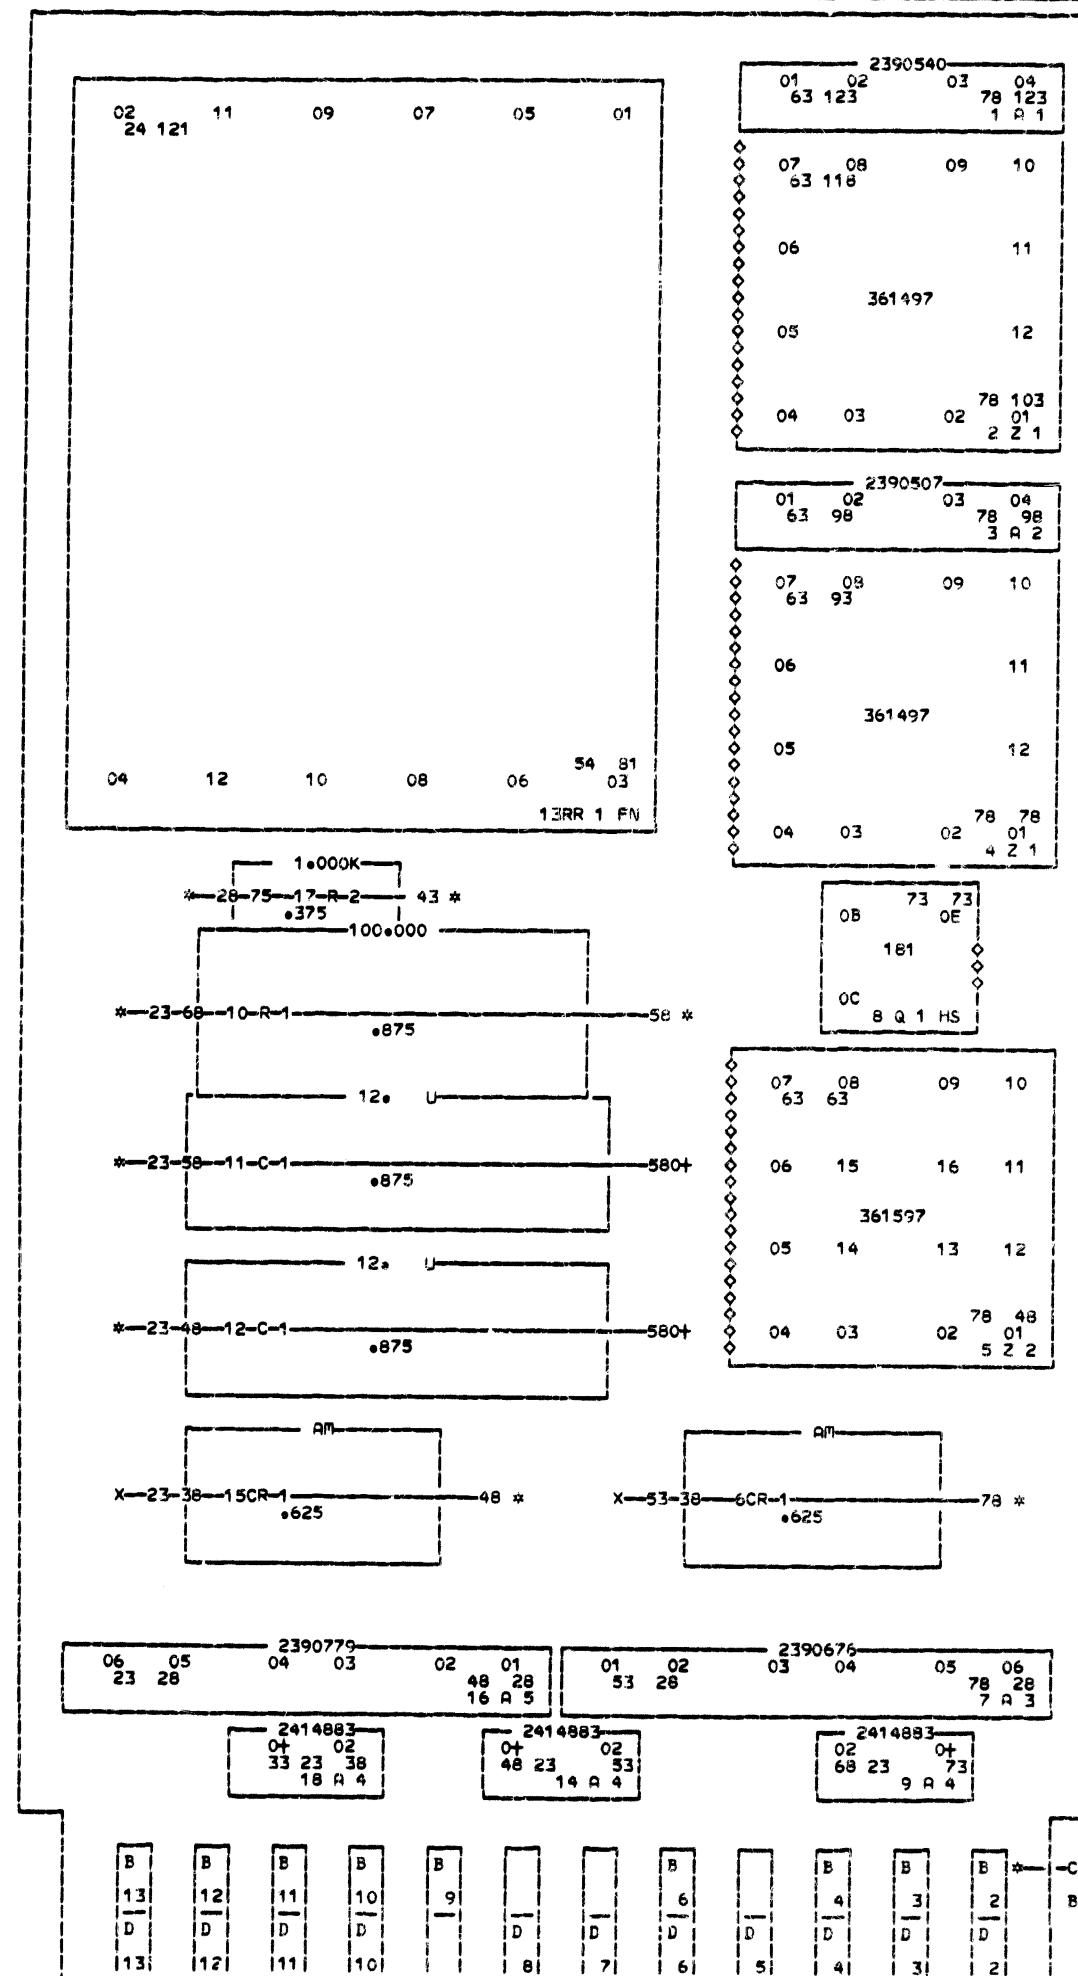

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	1	SELECT OUT BYPASS CARD 2		
DESIGN	04-03-67	W	TYPE	12820
DETAIL	04-03-67	W	SCALE	NONE
CHECK	04-07-67	MA	DRW	17090 112-22-67
APPRO	04-03-67	PHS	L.C.N.	5801452