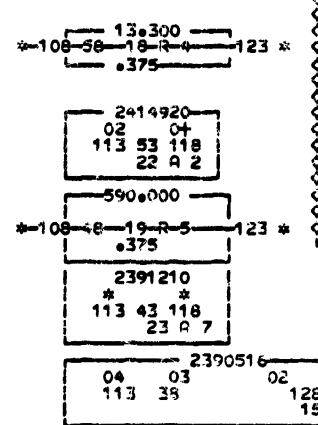
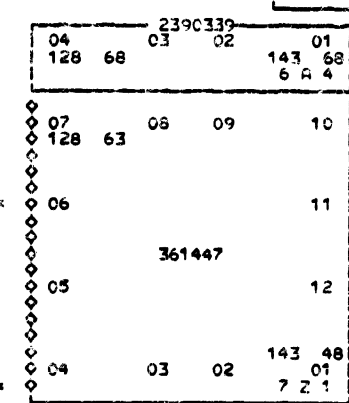
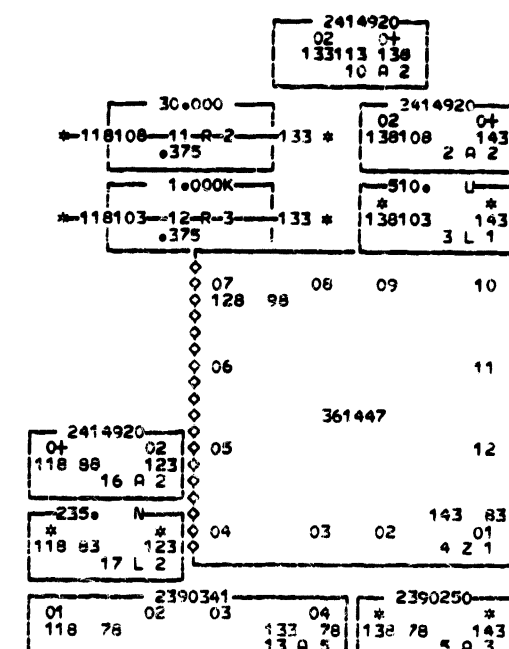

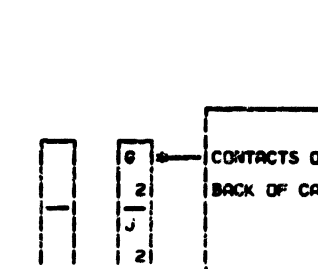
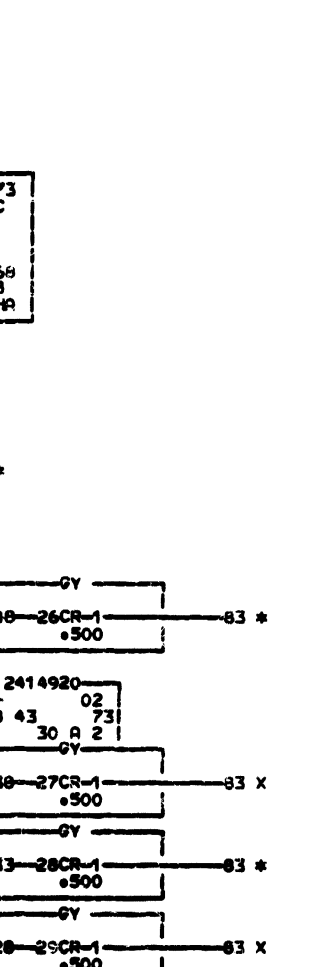
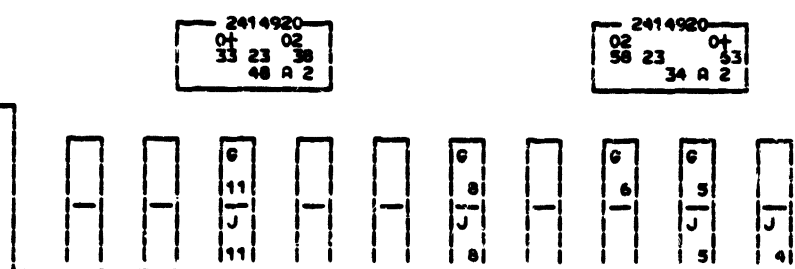
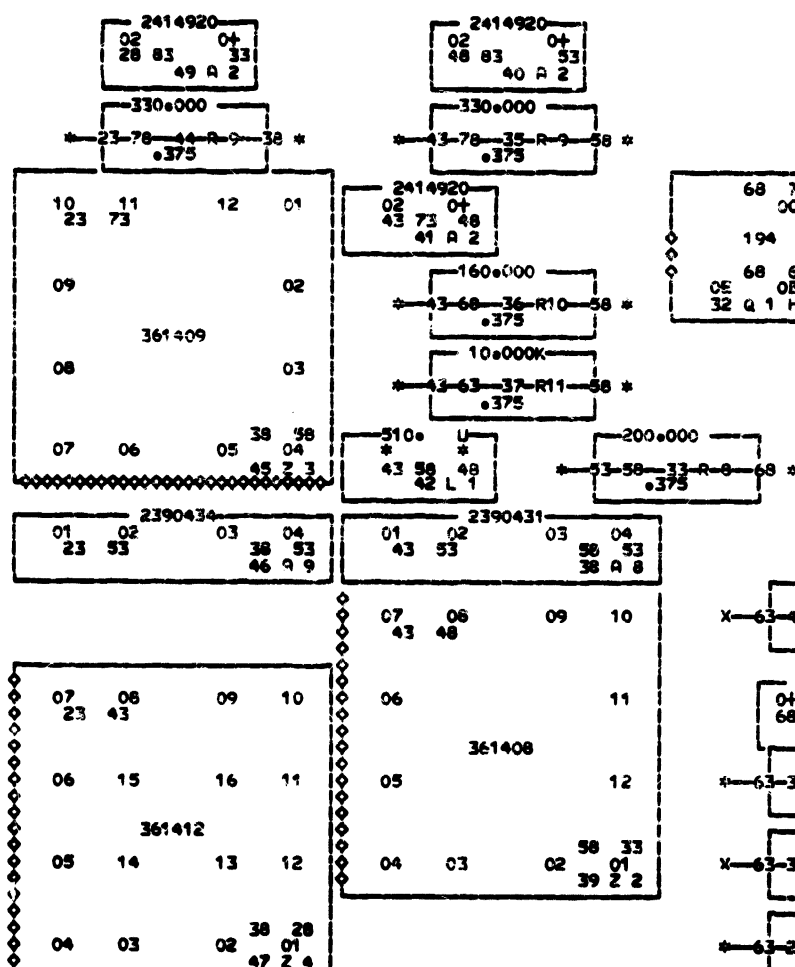
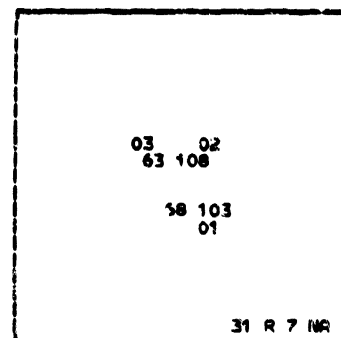
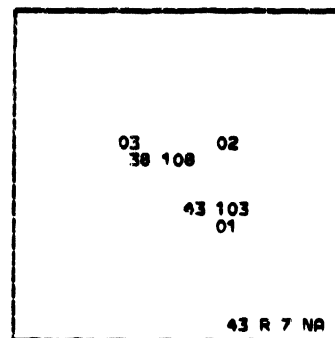


STANDARDS CODE	2-7045	SHEET 2 OF 5	5801515
CIRCUIT APPROVAL	PHS	05-18-67	STATUS ACTIVE
LOCATION	POUGHKEEPSIE		RESTRICTED
RAW CARD NUMBER	5817978	HOLE PAT. NO.	5817978
FRONT ARTWORK	DATE	CHANGE NO.	DATE
5817978	06-14-67	171326	A
BACK ARTWORK			
5817978			

PIN	VOLT.
B11	+ 6
D11	+ 6
D08	GND
J09	GND
B06	- 3
G06	- 3

CODE	PART NO	VALUE	QTY
R 1	216439	510.000	.25 + 5 2
R 2	5301519	30.000	.25 + 5 1
R 3	216445	1.000K	.25 + 5 1
R 4	814074	13.300	.10 + 1 1
R 5	814071	590.000	.10 + 1 1
R 6	216435	360.000	.25 + 5 1
R 7	492678	1.000K	1. + 5 2
R 8	492615	200.000	.25 + 5 1
R 9	216434	330.000	.25 + 5 2
R10	216430	160.000	.25 + 5 1
R11	216468	10.000K	.25 + 5 1
Ch 1	2414891	CV	4
Q 1	2414818	194 NPN	1
L 1	2391211	510. U	2
L 2	2391150	235. N	1
Z 1	361447	SLT MODULE	2
Z 2	361408	SLT MODULE	1
Z 3	361409	SLT MODULE	1
Z 4	361412	SLT MODULE	1
A 1	2414883	RC MODULE	1
A 2	2414920	RC MODULE	14
A 3	2390250	RC MODULE	1
A 4	2390339	RC MODULE	1
A 5	2390341	RC MODULE	1
A 6	2390516	RC MODULE	1
A 7	2391210	RC MODULE	1
A 8	2390431	RC MODULE	1
A 9	2390434	RC MODULE	1
FA			17
HA	811157	PTO-181 SPACER.	01

NOTES:
 AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
 AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913
 AK-C RD HAS BEEN DECOUPLED 811800 IS NOT APPLICABLE.
 FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
 ADDITIONAL USAGE TO BE AVOIDED
 HA-ASSEMBLE WITH P/N 811157 PTO-181 SPACER.
 NA-PART MUST NOT BE SUBJECTED TO ANY LIQUID.

INTERNATIONAL BUSINESS MACHINES CORP.				
NAME	CARD ASY-NOISE SENSOR			
DESIGN	05-04-67	WFS	TYPE	C13
DETAIL	05-18-67	RPV	SCALE	NONE
CHECK	05-09-67	REF	DATE	17090
APPRO	05-18-67	PHS	LOC. NO.	5801515
				LAMINATED