

STANDARDS CODE	2-7045		SHEET 2 OF 3	5801702
CIRCUIT APPROVAL	WAW	12-01-64	STATUS	ACTIVE
LOCATION	ENDICOTT			RESTRICTED
RAW CARD NUMBER	5819810		HOLE PATTERN	5819810
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5819810	- -			
BACK ARTWORK	04-04-65	163701	A	
5819810				

PIN	VOLT.
D08	GR
D06	-06
D03	+12

CODE	PART NO	VALUE	QTY
R 1	217082	820.000 .25 + 5	2
R 2	317015	750.000 .50 + 5	2
R 3	317016	820.000 .50 + 5	2
Q 1	369686	178 NPN	2
HS 1	211839	HEAT SINK	2
Z 1	361494	SLT MODULE	1
A 1	2414883	RC MODULE	2
PK	483151		00
HA	811157	SPACER	02

NOTES:

AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890913


FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.

ADDITIONAL USAGE TO BE AVOIDED

HA-ASSEMBLE WITH P/N 811157 (TO-18) SPACER.

AL-CARD HAS NOT BEEN DECOUPLED. 811800 IS NOT APPLICABLE.

FK-MOUNT HEAT SINK USING SI GREASE (P/N 483151) ON THE TRANSISTOR CAN. SI GREASE MUST BE APPLIED AFTER LIQUID PROCESS.

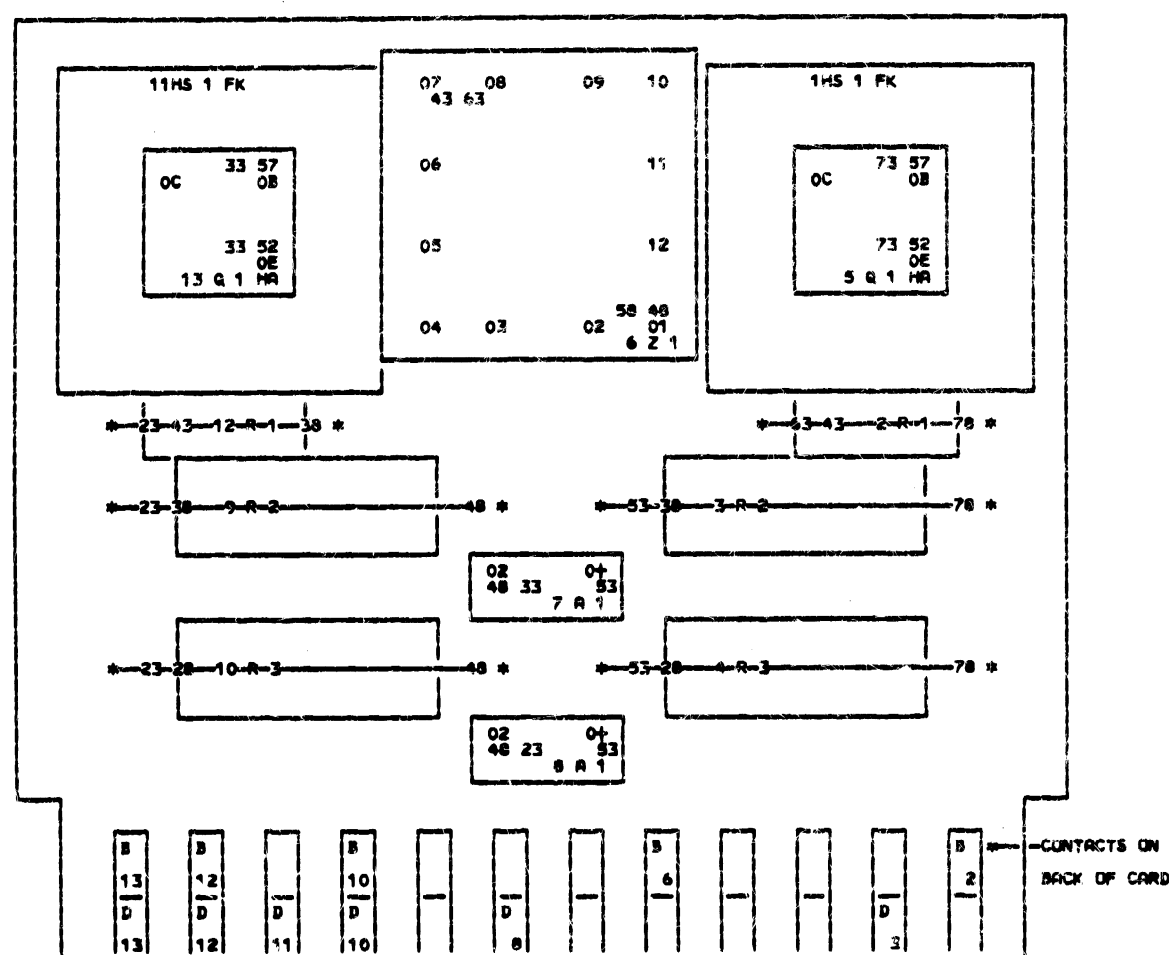

INTERNATIONAL BUSINESS MACHINES CORP.					
NAME	1	4 AMP DRIVER			
DESIGN	12-16-64	WRS	TYPE	1285	
DETAIL	01-05-65	VAD	SCALE	NONE	
CHECK	01-13-65	RDH	DATE	7090	04-01-65
APPRO	- -		LOC		