


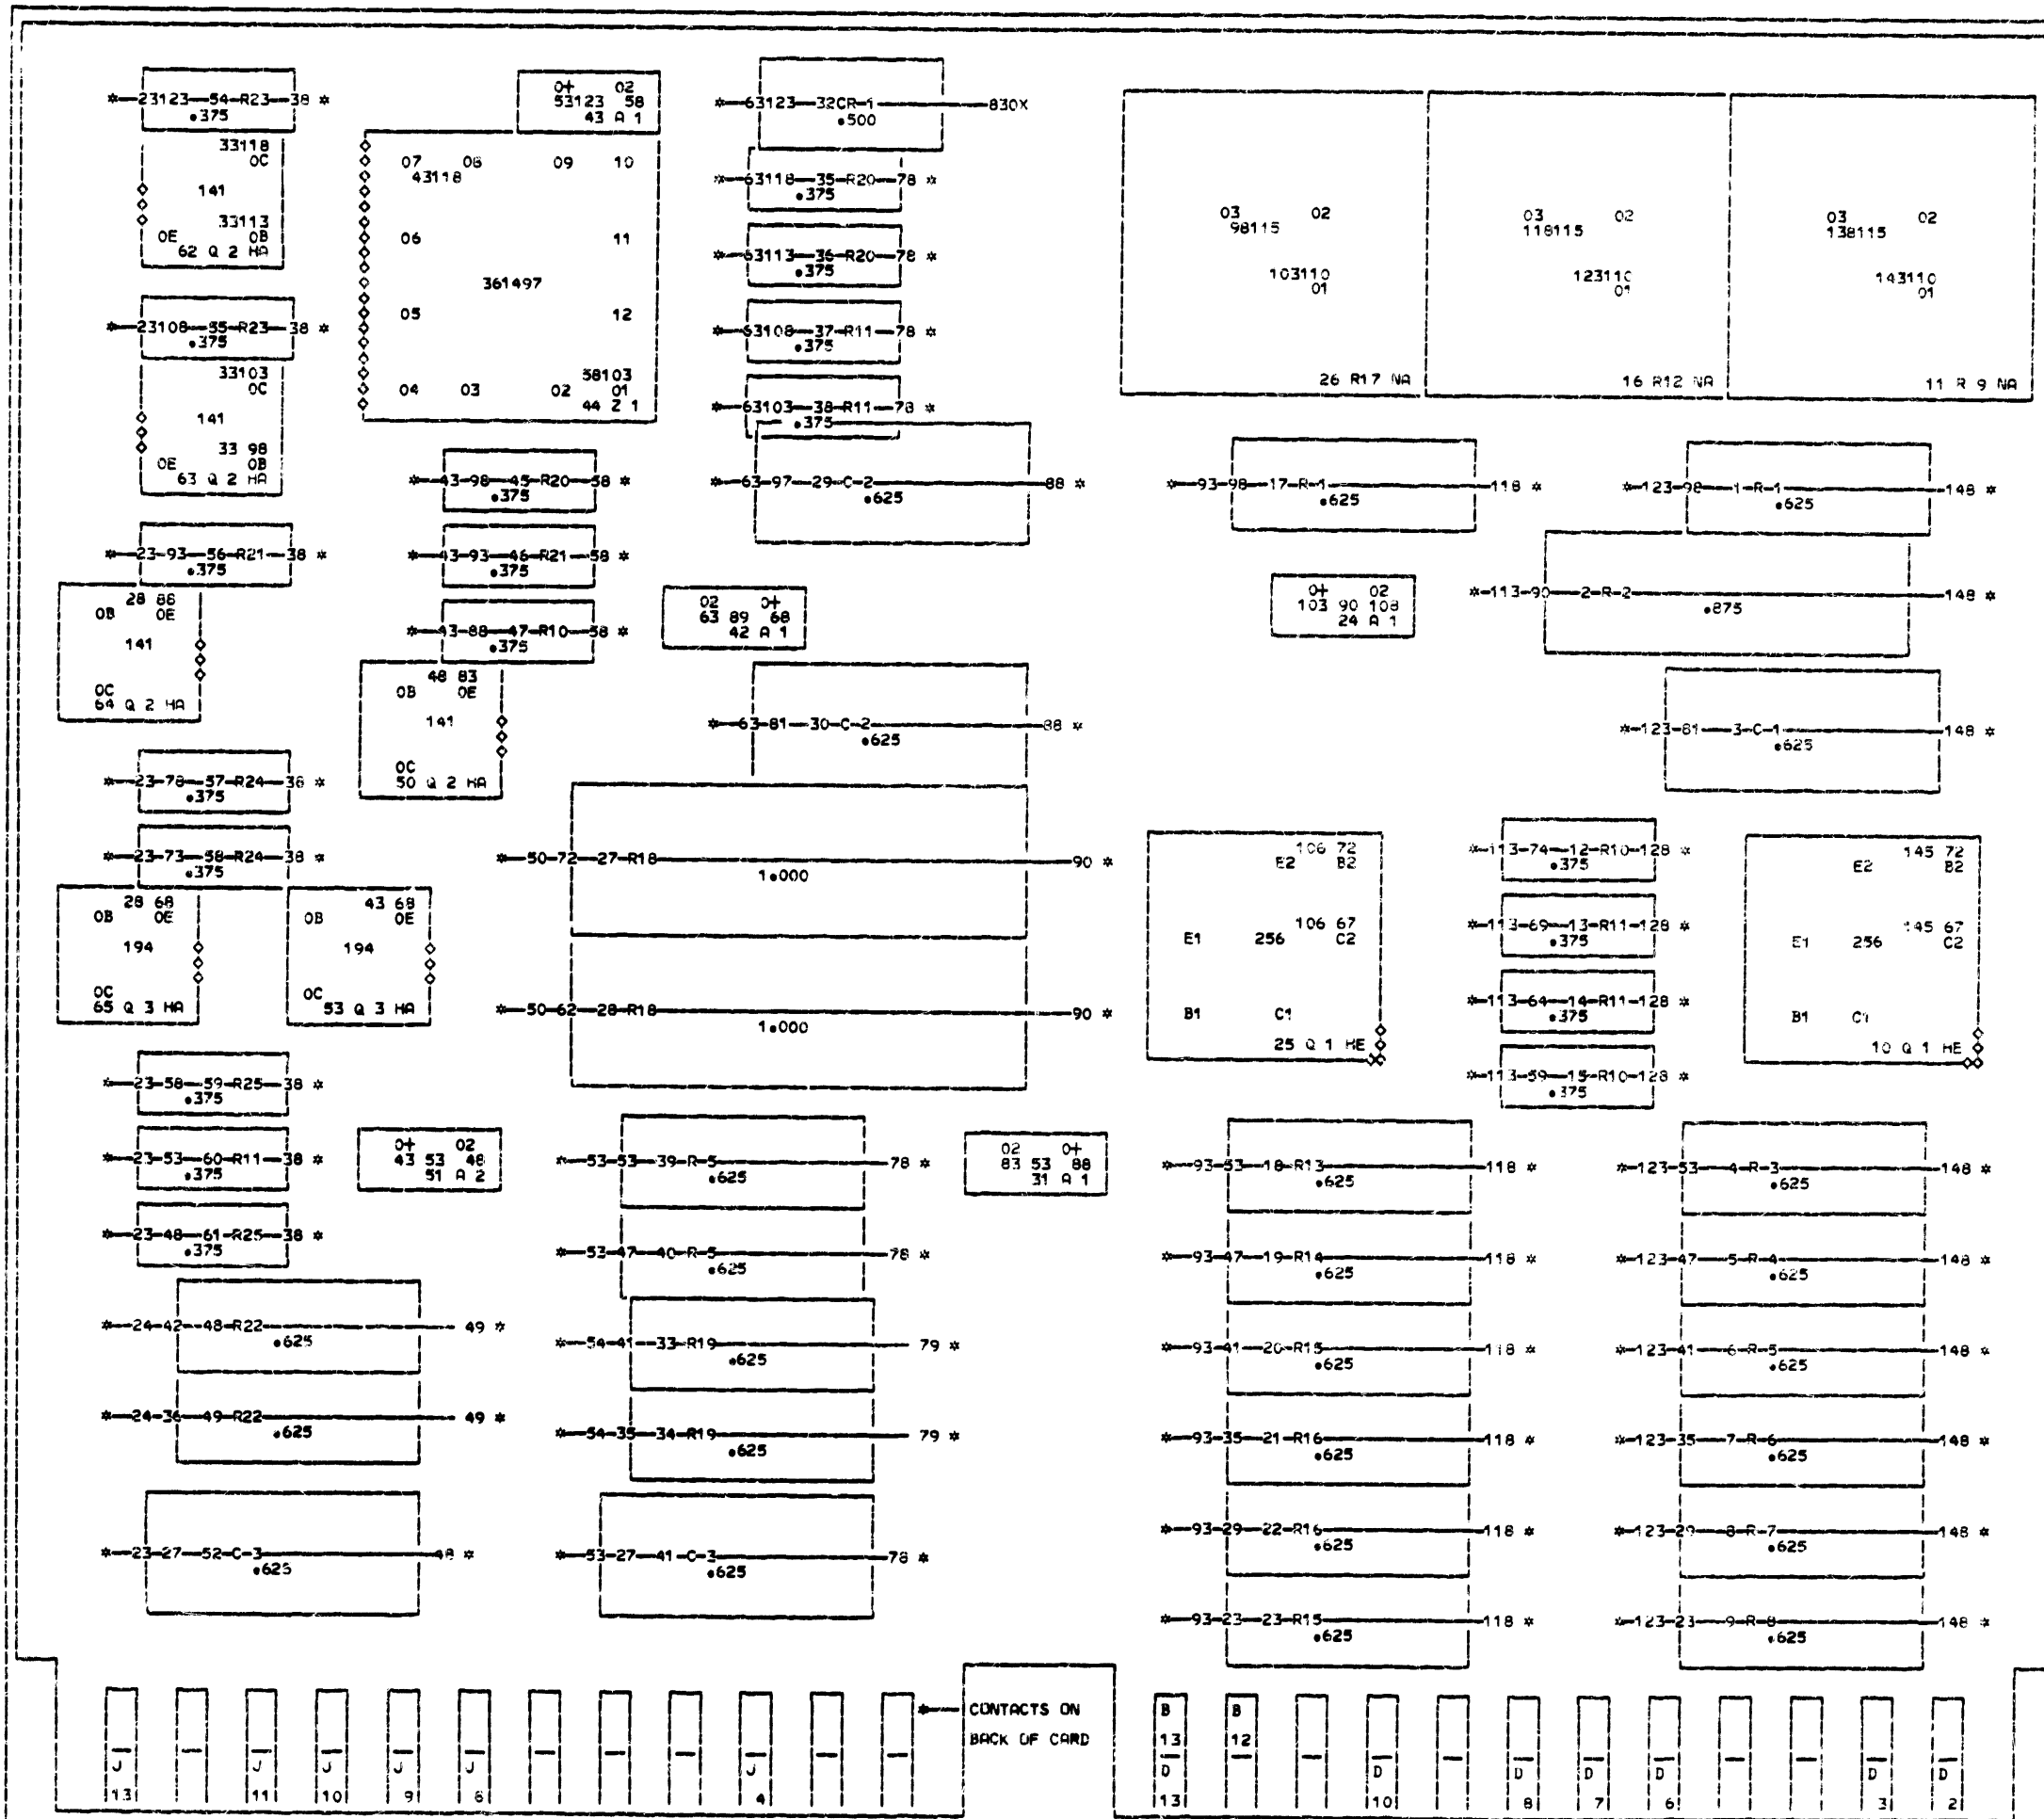

STANDARDS CODE	2-7045	SHEET 2 OF 31 5801758
CIRCUIT APPROVAL	ROCHESTER	STATUS
LOCATION	ROCHESTER	RESTRICTED
RAW CARD NUMBER	5819817	1
FRONT ARTWORK	DATE	CHANGE NO.
5819817	-	-
BACK ARTWORK	DATE	CHANGE NO.
5819817	12-10-65	163779
	10-30-66	168804

PIN	VOLT.
J13	+30
J08	GND
B13	+06
B12	+12
D06	GND
D03	-12
D02	-36

CODE	PART NO	VALUE	QTY
R 1	550017	374.000	12
R 2	432137	80.000K	25
R 3	479063	31.000K	12
R 4	479063	226.000	12
R 5	550020	1.000K	12
R 6	479026	33.000K	12
R 7	479199	29.000K	12
R 8	550450	280.000	12
R 9	492593	20.000K	12
R10	216445	1.000K	25
R11	595359	100.000	25
R12	483119	2.000K	12
R13	491212	953.000	12
R14	491212	2.000K	12
R15	479160	10.000K	12
R16	479135	4.000K	12
R17	422558	200.000	12
R18	481738	221.000K	50
R19	479016	51.100	12
R20	215463	5.000K	25
R21	216453	43.000K	25
R22	491221	39.000	50
R23	216457	8.100K	25
R24	216433	300.000	25
R25	492615	200.000	25
C 1	217036	8.2	1
C 2	217032	5.6	2
C 3	350432	150	2
CR 1	369368	DL	1
Q 1	2414850	256 NPN	2
Q 2	2414947	141 PNP	2
Q 3	2414819	194 NPN	2
Z 1	361497	SLT MODULE	1
RA 1	2414863	RC MODULE	4
RA 2	2414920	RC MODULE	1
HA	811157		10
HE	811660		10

NOTES:
 1. ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.
 2. ASSEMBLE TO ENGINEERING SPECIFICATION 890913.
 3. AL-CARD HAS NOT BEEN DECOUPLED. 811800 IS NOT APPLICABLE.
 4. FA-TECH LAB EVALUATION INCOMPLETE. PART SUBJECT TO WITHDRAWAL.
 5. ADDITIONAL USAGE TO BE AVOIDED.
 6. HA-ASSEMBLE WITH PIN 811157. PTO-184 SPACER.
 7. HE-ASSEMBLE WITH PIN 811660. PTO-521 SPACER. TRANSISTOR TAB IS BETWEEN THE TWO COLLECTORS.
 8. HA-PART MUST NOT BE SUBJECTED TO ANY LIQUID.

INTERNATIONAL BUSINESS MACHINES CORP.					
NAME	Yoke Driver Driver				
DESIGN	10-23-65	RJM	TYPE		
DETAIL	10-25-65	REP	SCALE	NONE	
CHECK	10-25-65	RJM	DRAW	7090	10-25-66
APPRO	-	-	LOC	-	