

STANDARDS CODE	2-6235		SHEET 2 OF 3	5803551
CIRCUIT APPROVAL		- -	STATUS	ACTIVE
LOCATION	Endicott			RESTRICTED
RAW CARD NUMBER	5815734	3	HOLE PATTERN	5815734
FRONT ARTWORK	DATE	CHANGE NO.	DATE	CHANGE NO.
5815734	0313-64	DEV2568	09-23-65	165717 B
BACK ARTWORK	032564	DEV2844	12-15-67	173087 C
5815734	03-25-64	160257		

PIN	VOLT.
D 9	GND
D 3	+ 3
B 11	+ 6
B 6	- 3

CODE	PART NO	VALUE	QTY
R 1	492351	24.000	.50 + 5 1
R 2	216481	36.000K	.25 + 5 1
R 3	216464	6.800K	.25 + 5 1
R 4	216474	18.000K	.25 + 5 1
R 5	216461	5.100K	.25 + 5 1
R 6	481752	309.000K	.50 + 1 1
C 1	2414867	47. U	1
CR 1	2106333	ALS	1
Z 1	361497	SLT MODULE	1
Z 2	361459	SLT MODULE	1
Z 3	361493	SLT MODULE	1
RR 1	766040	NO-01 NC-00	1
FN	815198		06


NOTES:

AA-ALL CIRCUITS MUST CONFORM TO ENG. SPEC. SHOWN ON SHEET 1.

AB-ASSEMBLE TO ENGINEERING SPECIFICATION 890513

AL-CARD HAS NOT BEEN DECOUPLED. 811500 IS NOT APPLICABLE.

FN-CONTACTS PIN 815198 TO BE INSERTED BEFORE LIQUID PROCESS PER
ENG. SPEC. 8711830 REEL RELAY ASSEMBLY TO BE HAND MOUNTED ON
CONTACTS AFTER LIQUID PROCESS.

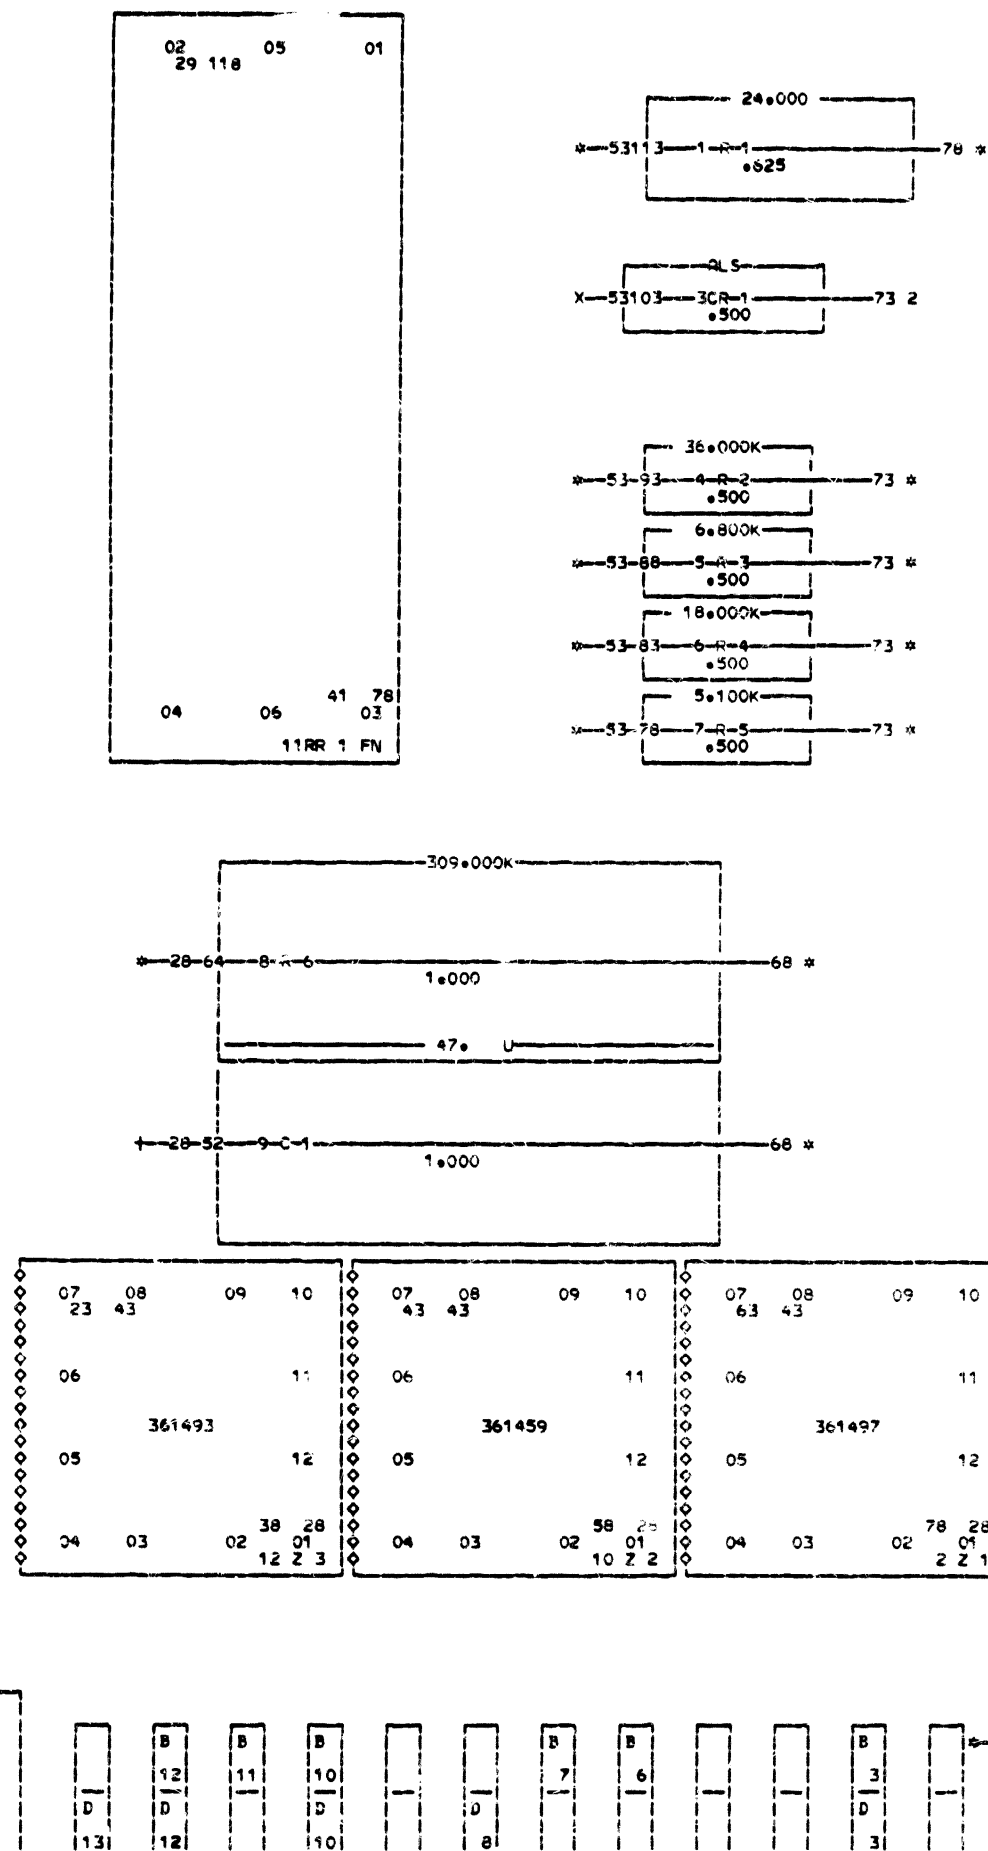

INTERNATIONAL BUSINESS MACHINES CORP.					
NAME	3-0-8-6 SECOND TIMEOUT				
DESIGN	102-12-64	IJS	TYPE	11442	
DETAIL	02-18-64	IDE	SCALE	NONE	
CHECK	02-20-64	TH	DRAW	17090	100-00-00
APPRO	- -		LoCoNo		